

## **AN-1706 LMX9838 Firmware Release Note**

---

### **ABSTRACT**

This application note describes all release changes within the LMX9838 firmware.

---

### **Contents**

1	Introduction .....	2
2	Key Considerations on Converting From v2.12 to Latest Revision .....	2
	2.1 Firmware Version in Ready Event .....	2
	2.2 Patches .....	3
3	Known Bugs .....	5
	3.1 Version 2.12 .....	5
4	Workarounds .....	5
	4.1 Safe Reset Timing .....	5
	4.2 Recover from EEPROM Lockup .....	7
5	Firmware Release History .....	8
	5.1 Version 2.12 .....	8
	5.2 Patch 10 .....	8
	5.3 Patch 2 .....	8
	5.4 Patch 1 (Test Patch) .....	9

### **List of Figures**

1	“SimplyBlue Ready” in Simply Blue Commander .....	3
2	Write ROM Patch Flow .....	4
3	Safe Reset Timing on Power-up or After Hardware Reset .....	6
4	Safe Reset Timing on Software Reset .....	6
5	Step 1, Write BD_Addr .....	7
6	Step 2/3, Apply Patch 10 and Enter BT_Mode .....	7
7	Step 4, Send Software Reset .....	8

### **List of Tables**

1	LMX9838 Module Configuration .....	2
2	List of Known Bugs on Firmware v2.12 .....	5
3	Firmware Release Changes 2.12 .....	8
4	Firmware Patch 10 v2.12 .....	8
5	Firmware Patch 2 v2.12 Changes .....	8
6	Firmware Patch 1 v2.12 Changes .....	9

TI is a trademark of Texas Instruments.  
Bluetooth is a registered trademark of Bluetooth SIG.  
All other trademarks are the property of their respective owners.

## 1 Introduction

The LMX9838 Bluetooth® Serial Port module is a highly integrated radio, baseband controller, memory device, crystal, antenna and loop filter and internal EEPROM. All hardware and the on-chip ROM firmware is included to provide a complete solution from antenna through the complete lower and upper layers of the Bluetooth stack, up to the application including the Generic Access Profile (GAP), the Service Discovery Application Profile (SDAP), and the Serial Port Profile (SPP). The module includes a configurable service database to fulfill service requests for additional profiles on the host.

LMX9838 is optimized to handle the data and link management processing requirements of a Bluetooth node. The firmware supplied within this device offers a complete Bluetooth (v2.0) stack including profiles and command interface. This firmware features point-to-point and point-to-multipoint link management supporting data rates up to the theoretical maximum over RFCOMM of 704 kbps. The internal memory supports up to 7 active Bluetooth data links and 1 active SCO link.

Due to our continuously ongoing quality tests and firmware improvements, several changes to the firmware have been made to provide highest reliability and performance and they are discussed in the sections to follow.

This document is based on:

**Table 1. LMX9838 Module Configuration**

Item	Version
Hardware	LMX9838
Firmware	v2.12
Actual Firmware Release in production	v2.12

## 2 Key Considerations on Converting From v2.12 to Latest Revision

Since the LMX9838 is ROM based, firmware upgrades can only be done by complete ROM spins, which result in a new chip delivered by Texas Instruments.

Software developers should keep the following considerations in mind to prepare the host software for future upgrades of the LMX9838 ROM code. TI™, of course, will try keep to 100% backwards compatibility to avoid problems when replacing existing devices in your products. However, some important issues need to be considered in software.

### 2.1 Firmware Version in Ready Event

Each LMX9838 comes up with a certain “Ready” Event, which indicates the completed boot process of the device. This event also includes the firmware version of the device. The “Ready” appears after boot or after a software reset.

See [Figure 1](#) for a screenshot of the event in Simply Blue Commander.

For example, the LMX9838 will come up with the hexadecimal code:

Rx(RAW): 02,69,25,05,00,93,04,**30,32,31,32**,03

on which the bold bytes indicate the firmware version (in this case 0212).

**Note:** In order to avoid any future upgrade problems, please make sure your software does not use this parameter as part of the decision to continue. The parameter should just be used for informational purposes.

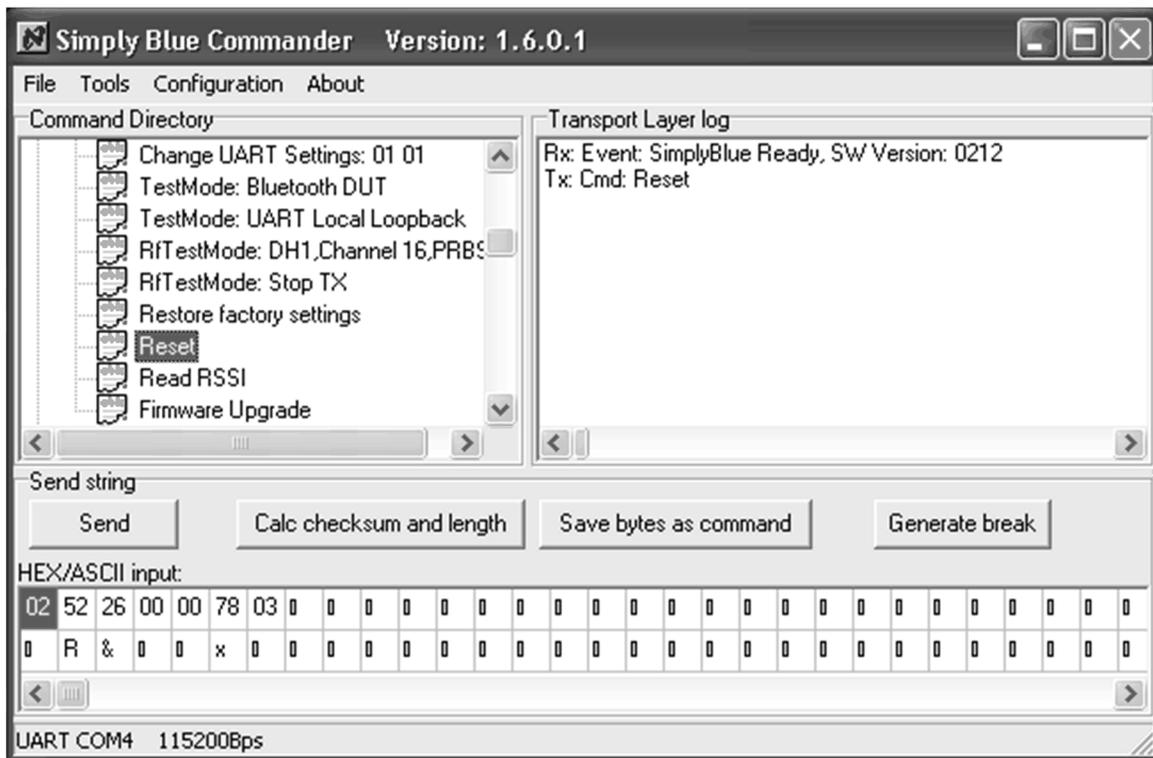


Figure 1. “SimplyBlue Ready” in Simply Blue Commander

## 2.2 Patches

LMX9838 includes the functionality of patching, which allows small bug fixing and firmware modifications. The latest patches are distributed and can be downloaded at the Simply Blue Developers website. Please see [Section 5](#) for patches available at release of this document.

Since patches are specific to each firmware release, the patches should only be applied to those devices. To avoid, that a wrong patch is applied to the firmware, the patch includes the firmware version information, which is verified by the LMX9838 firmware at the beginning of the patching process.


### 2.2.1 Patch in pre-programmed EEPROM

The LMX9838 includes an internal EEPROM, in which the patch can be stored and will be fetched on each boot process. On normal boot-up, the LMX9838 will check the existence of the EEPROM and will apply the data stored.

### 2.2.2 Patch in EEPROM, but Supplied via Command Interface

In case the EEPROM is not pre-programmed or requires a patch newer than the one already stored, the patch would need to be stored via the command interface from either the host or a manufacturing device.

In case a patch needs to be supplied using the “Write ROM Patch” command, the mechanism to take care of requires a specific command flow to be followed. See [Figure 2](#) for the general patch flow. The complete process is also described in the *AN-1699 LMX9838 Software Users Guide (SNOA498)*. Since the patch is stored in EEPROM, this only needs to be done once.

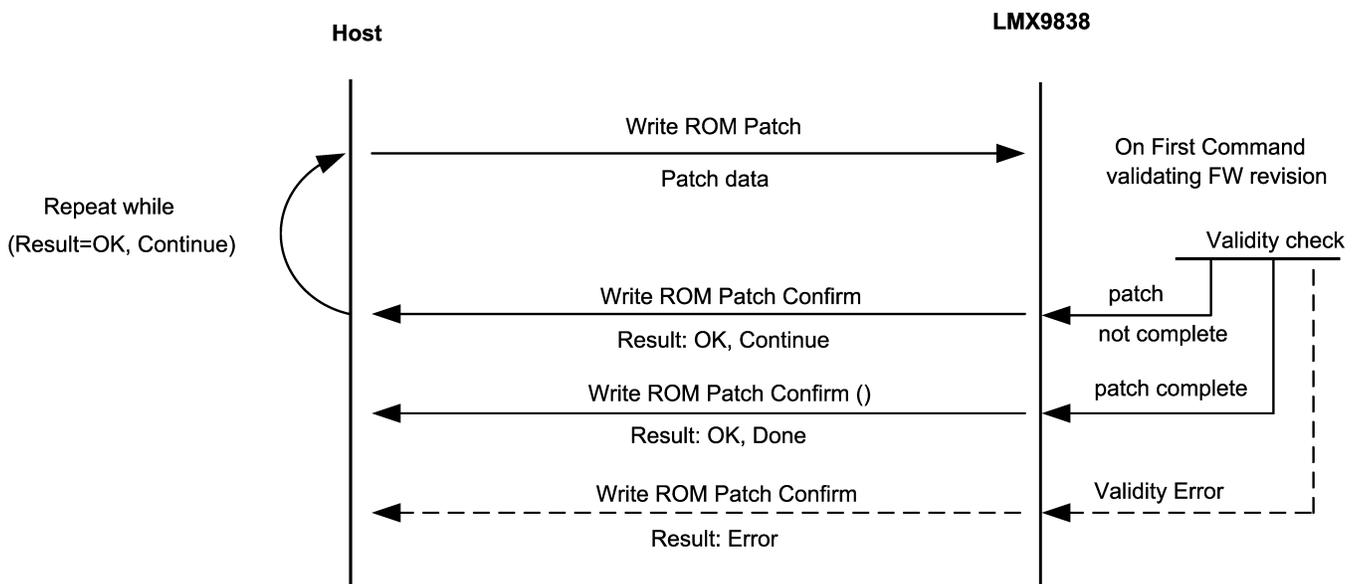
**Figure 2. Write ROM Patch Flow**

The Write ROM patch mechanism includes a validity check of the ROM pushed to the device. In case no error is found, the error code is either 0x01 for Continue or 0x00 for OK, Done.

In case the error code is different to those two, an error must have occurred. The following error codes are defined:

- 0x00 = Ok, Done.
- 0x01 = Ok, Continue.
- 0x80 = Error, Not enough info to continue download (a “global” or “segment” meta data group appears to be split).
- 0x81 = Error, Not enough resources to continue download.
- 0x82 = Error, Patch too big.
- 0x83 = Error, Unsupported Patch format revision.
- 0x84 = Error, Patch not applicable to firmware in device.
- 0x85 = Error, Patch CRC check failed.
- 0x86 = Error, Patch NVS validation failed.
- 0x87 = Error, RAMAddr or VarAddr out of RAM area.
- 0xFF = Error, Unspecified error.

In case the host tries to apply a patch released for Firmware 2.12, to another firmware, the Confirm will respond with error message 0x84.

**Therefore the software needs to be prepared to handle this error code correctly by either continuing with the normal boot process without the patch, or to try to apply a patch for another firmware version.**

**To be prepared for future upgrades, the host application should not stop the execution due to this error code.**

### 3 Known Bugs

#### 3.1 Version 2.12

**Table 2. List of Known Bugs on Firmware v2.12**

Bug Type	Description	Workaround
Transmission Problem in command mode	When the module is in command mode, Data pending are not flushed when the RFCOMM connection is terminated by link time-out.	Patch 2
SDAP_SERVICE_REQ UEST command confirm wrong	Confirm includes additional wrong byte after the correct handle on position 3+4*Length (Last byte of payload).	Ignore Last Payload Byte
EEPROM locked up by hardware reset	The EEPROM might lock up in case the LMX9838 Reset is pulled low during a read cycle. This mainly can happen on power up or after a software or hardware reset.	See <a href="#">Section 4.1</a> for preventing lockup and <a href="#">Section 4.2</a> for recovering from lockup

### 4 Workarounds

#### 4.1 Safe Reset Timing

The LMX9838 stores all non-volatile information like service database, local name, Bluetooth device address, and patches into an integrated EEPROM. The EEPROM is connected to the internal baseband controller through a serial interface.


On power-up, after hardware or software reset, the EEPROM content is read back from the baseband controller.

Applying the Hardware Reset (using pin Reset#) of the LMX9838 only resets the baseband controller within the device. The EEPROM keeps the last status and is only “reset” by power cycling the complete module. In case the Hardware Reset is applied while the EEPROM is accessed by the baseband controller, it may occur that the EEPROM locks up on the serial interface and can not be accessed from the baseband controller anymore. The result of this is, the LMX9838 will respond with the “Await initialization” Event, which indicates, that the Bluetooth address could not be read from the EEPROM.


To avoid this scenario, the LMX9838 RESET# must not be pulled low between one of the following events and the device sending the “Ready” Event on the UART interface:

- On power-up (after pulling Reset# high)
- After a hardware reset (using the pin Reset#)
- After a software reset (using the command “Reset”)

If it is not possible to read back the “Ready” Event for example, it is not possible to parse the LMX9838 events), the workaround can be implemented by waiting for about 1 second, before re-applying the hardware reset again. The estimated maximum time for the firmware to initialize is about 900milliseconds, so 1 second should give enough margin.

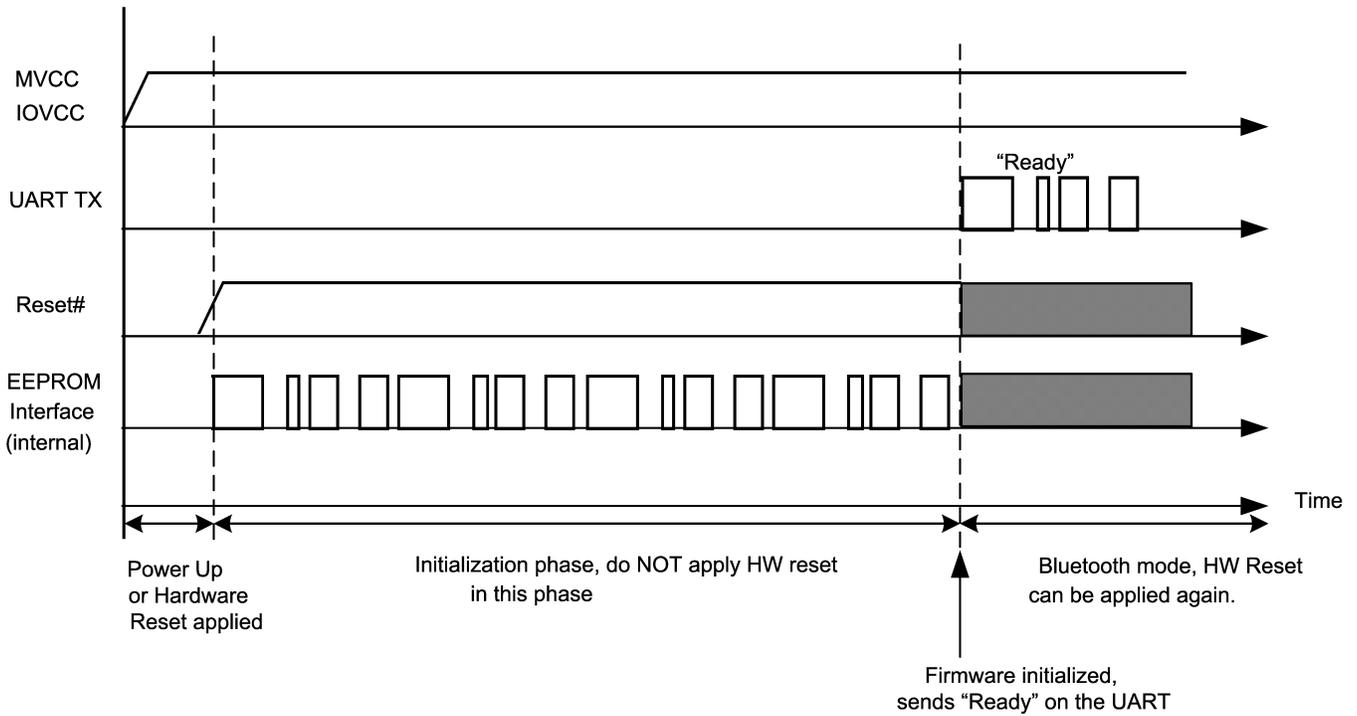

**Figure 3. Safe Reset Timing on Power-up or After Hardware Reset**

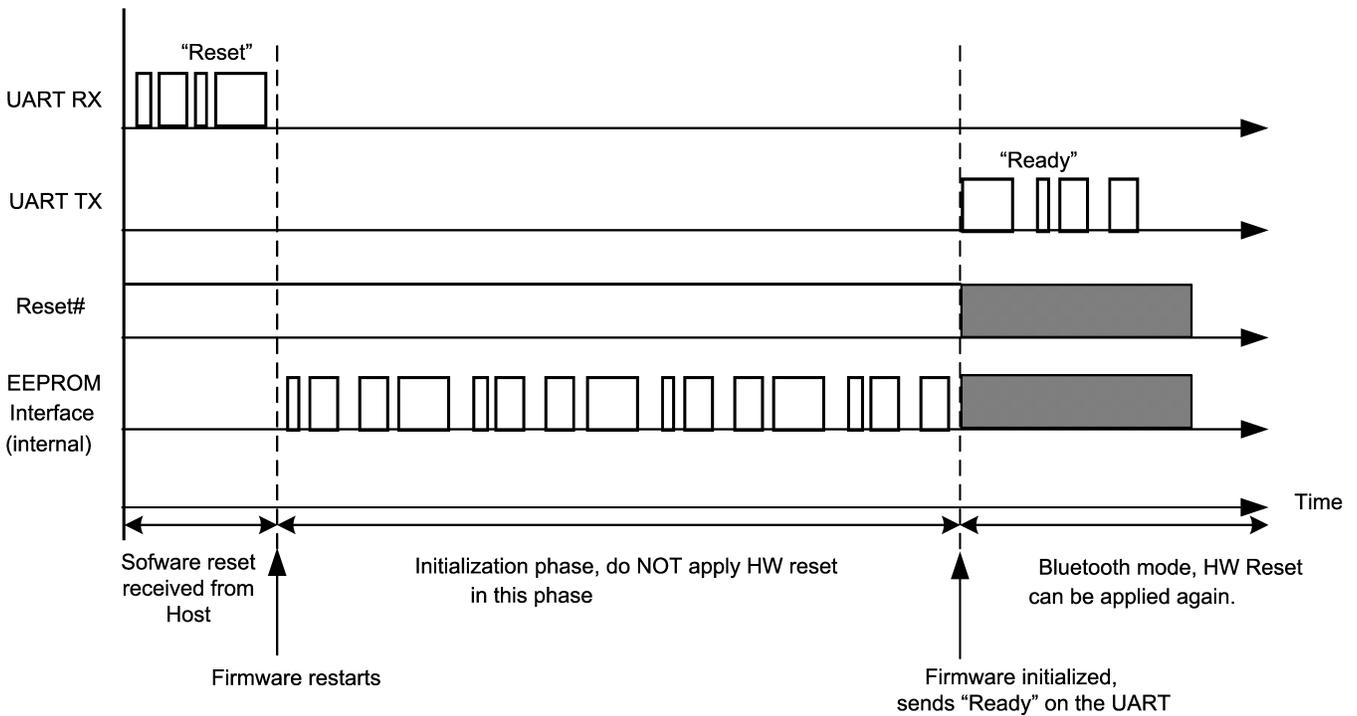


**Figure 4. Safe Reset Timing on Software Reset**

## 4.2 Recover from EEPROM Lockup

If a Hardware reset, Software reset or Power up occurs during the EEPROM initialization phase, the EEPROM might be unrecognized and might lock-up. If this situation happens, there is a way to recover and reset the module. On receiving the AWAIT\_INITIALIZATION\_EVENT perform the following steps:


1. Write BD\_ADDR
2. Load the Patch 10
3. Send ENTER\_BLUETOOTH\_MODE command
4. Send RESET command

After sending the BD\_ADDR write command, the SimplyBlue commander log window should look like the following.

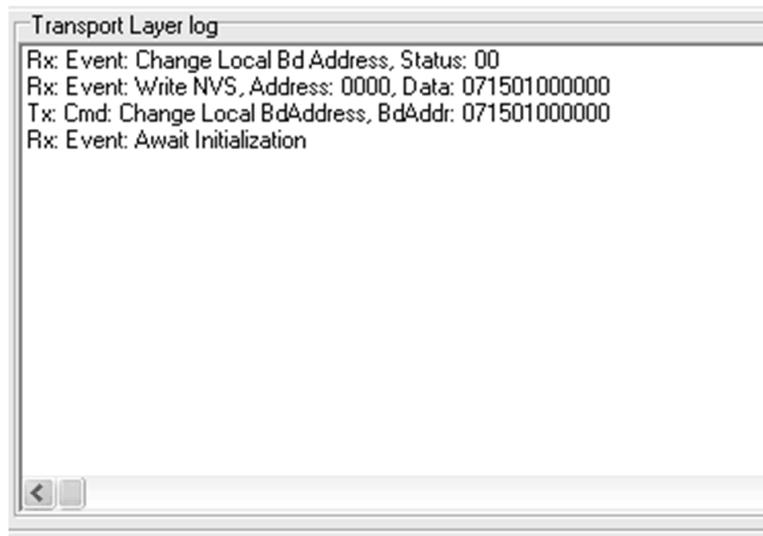

**Figure 5. Step 1, Write BD\_Addr**

After sending the Patch 10 and Enter Bluetooth Mode command, the log window should show:

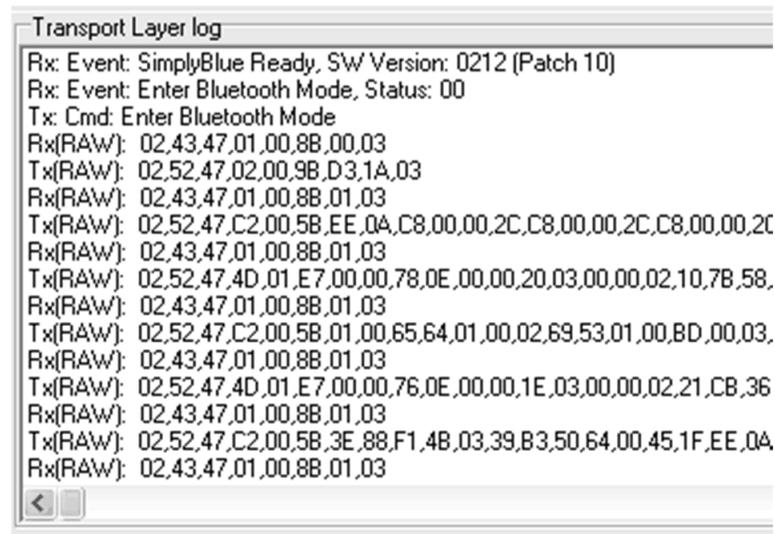

**Figure 6. Step 2/3, Apply Patch 10 and Enter BT\_Mode**

Finally after software reset the module recovers and is back to its normal operation mode.

```

Transport Layer log
Rx: Event: SimplyBlue Ready, SW Version: 0212 (Patch 2)
Tx: Cmd: Reset
Rx: Event: SimplyBlue Ready, SW Version: 0212 (Patch 10)
Rx: Event: Enter Bluetooth Mode, Status: 00
Tx: Cmd: Enter Bluetooth Mode
Rx(RAW): 02,43,47,01,00,88,00,03
Tx(RAW): 02,52,47,02,00,9B,D3,1A,03
Rx(RAW): 02,43,47,01,00,88,01,03
Tx(RAW): 02,52,47,C2,00,5B,EE,0A,C8,00,00,2C,C8,00,00,2C,C8,0
Rx(RAW): 02,43,47,01,00,88,01,03
Tx(RAW): 02,52,47,4D,01,E7,00,00,78,0E,00,00,20,03,00,00,02,10
Rx(RAW): 02,43,47,01,00,88,01,03
Tx(RAW): 02,52,47,C2,00,5B,01,00,65,64,01,00,02,69,53,01,00,BD
Rx(RAW): 02,43,47,01,00,88,01,03
Tx(RAW): 02,52,47,4D,01,E7,00,00,76,0E,00,00,1E,03,00,00,02,21
Rx(RAW): 02,43,47,01,00,88,01,03
    
```

**Figure 7. Step 4, Send Software Reset**

## 5 Firmware Release History

Release date: January 2006

### 5.1 Version 2.12

**Table 3. Firmware Release Changes 2.12**

Issue	Type	Description
None	None	Initial release.

### 5.2 Patch 10

Release date: September 2007

**NOTE:** This is a Patch workaround but not an EEPROM Patch. It should not be stored in EEPROM. See [Section 4.2](#) for details on how using this Patch.

**Table 4. Firmware Patch 10 v2.12**

Issue	Type	Description
EEPROM Lockup	Workaround	EEPROM not recognized: the module sends the "Await_Initialization_Event" on boot-up. See <a href="#">Section 4.2</a> for details.

### 5.3 Patch 2

Release date: July 2006

**Table 5. Firmware Patch 2 v2.12 Changes**

Issue	Type	Description
Transmission Problem in command mode when link terminated by link time-out	Bug Fix	When the module is in command mode, Data pending are not flushed when the RFCOMM connection is terminated by link timeout. This could cause the device to be stuck.

## 5.4 Patch 1 (Test Patch)

Release date: January 2006

**Table 6. Firmware Patch 1 v2.12 Changes**

Issue	Type	Description
None	Validation	Internal use. Test Patch for validation.

## IMPORTANT NOTICE

Texas Instruments Incorporated and its subsidiaries (TI) reserve the right to make corrections, enhancements, improvements and other changes to its semiconductor products and services per JESD46, latest issue, and to discontinue any product or service per JESD48, latest issue. Buyers should obtain the latest relevant information before placing orders and should verify that such information is current and complete. All semiconductor products (also referred to herein as "components") are sold subject to TI's terms and conditions of sale supplied at the time of order acknowledgment.

TI warrants performance of its components to the specifications applicable at the time of sale, in accordance with the warranty in TI's terms and conditions of sale of semiconductor products. Testing and other quality control techniques are used to the extent TI deems necessary to support this warranty. Except where mandated by applicable law, testing of all parameters of each component is not necessarily performed.

TI assumes no liability for applications assistance or the design of Buyers' products. Buyers are responsible for their products and applications using TI components. To minimize the risks associated with Buyers' products and applications, Buyers should provide adequate design and operating safeguards.

TI does not warrant or represent that any license, either express or implied, is granted under any patent right, copyright, mask work right, or other intellectual property right relating to any combination, machine, or process in which TI components or services are used. Information published by TI regarding third-party products or services does not constitute a license to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

Reproduction of significant portions of TI information in TI data books or data sheets is permissible only if reproduction is without alteration and is accompanied by all associated warranties, conditions, limitations, and notices. TI is not responsible or liable for such altered documentation. Information of third parties may be subject to additional restrictions.

Resale of TI components or services with statements different from or beyond the parameters stated by TI for that component or service voids all express and any implied warranties for the associated TI component or service and is an unfair and deceptive business practice. TI is not responsible or liable for any such statements.

Buyer acknowledges and agrees that it is solely responsible for compliance with all legal, regulatory and safety-related requirements concerning its products, and any use of TI components in its applications, notwithstanding any applications-related information or support that may be provided by TI. Buyer represents and agrees that it has all the necessary expertise to create and implement safeguards which anticipate dangerous consequences of failures, monitor failures and their consequences, lessen the likelihood of failures that might cause harm and take appropriate remedial actions. Buyer will fully indemnify TI and its representatives against any damages arising out of the use of any TI components in safety-critical applications.

In some cases, TI components may be promoted specifically to facilitate safety-related applications. With such components, TI's goal is to help enable customers to design and create their own end-product solutions that meet applicable functional safety standards and requirements. Nonetheless, such components are subject to these terms.

No TI components are authorized for use in FDA Class III (or similar life-critical medical equipment) unless authorized officers of the parties have executed a special agreement specifically governing such use.

Only those TI components which TI has specifically designated as military grade or "enhanced plastic" are designed and intended for use in military/aerospace applications or environments. Buyer acknowledges and agrees that any military or aerospace use of TI components which have **not** been so designated is solely at the Buyer's risk, and that Buyer is solely responsible for compliance with all legal and regulatory requirements in connection with such use.

TI has specifically designated certain components as meeting ISO/TS16949 requirements, mainly for automotive use. In any case of use of non-designated products, TI will not be responsible for any failure to meet ISO/TS16949.

### Products

Audio	<a href="http://www.ti.com/audio">www.ti.com/audio</a>
Amplifiers	<a href="http://amplifier.ti.com">amplifier.ti.com</a>
Data Converters	<a href="http://dataconverter.ti.com">dataconverter.ti.com</a>
DLP® Products	<a href="http://www.dlp.com">www.dlp.com</a>
DSP	<a href="http://dsp.ti.com">dsp.ti.com</a>
Clocks and Timers	<a href="http://www.ti.com/clocks">www.ti.com/clocks</a>
Interface	<a href="http://interface.ti.com">interface.ti.com</a>
Logic	<a href="http://logic.ti.com">logic.ti.com</a>
Power Mgmt	<a href="http://power.ti.com">power.ti.com</a>
Microcontrollers	<a href="http://microcontroller.ti.com">microcontroller.ti.com</a>
RFID	<a href="http://www.ti-rfid.com">www.ti-rfid.com</a>
OMAP Applications Processors	<a href="http://www.ti.com/omap">www.ti.com/omap</a>
Wireless Connectivity	<a href="http://www.ti.com/wirelessconnectivity">www.ti.com/wirelessconnectivity</a>

### Applications

Automotive and Transportation	<a href="http://www.ti.com/automotive">www.ti.com/automotive</a>
Communications and Telecom	<a href="http://www.ti.com/communications">www.ti.com/communications</a>
Computers and Peripherals	<a href="http://www.ti.com/computers">www.ti.com/computers</a>
Consumer Electronics	<a href="http://www.ti.com/consumer-apps">www.ti.com/consumer-apps</a>
Energy and Lighting	<a href="http://www.ti.com/energy">www.ti.com/energy</a>
Industrial	<a href="http://www.ti.com/industrial">www.ti.com/industrial</a>
Medical	<a href="http://www.ti.com/medical">www.ti.com/medical</a>
Security	<a href="http://www.ti.com/security">www.ti.com/security</a>
Space, Avionics and Defense	<a href="http://www.ti.com/space-avionics-defense">www.ti.com/space-avionics-defense</a>
Video and Imaging	<a href="http://www.ti.com/video">www.ti.com/video</a>

### TI E2E Community

[e2e.ti.com](http://e2e.ti.com)