

# MSP430F5525 Device Erratasheet

---



---



---

The revision of the device can be identified by the revision letter on the [Package Markings](#) or by the [HW\\_ID](#) located inside the TLV structure of the device

## 1 Functional Errata Revision History

Errata impacting device's operation, function or parametrics.

✓ The check mark indicates that the issue is present in the specified revision.

Errata Number	Rev K	Rev I	Rev H	Rev G	Rev F	Rev E	Rev D	Rev C
ADC25		✓	✓	✓	✓	✓	✓	✓
ADC27						✓	✓	✓
ADC29						✓		
ADC42	✓	✓	✓	✓	✓	✓	✓	✓
ADC69	✓	✓	✓	✓	✓	✓	✓	✓
COMP10	✓	✓	✓	✓	✓	✓	✓	✓
CPU37	✓	✓	✓	✓	✓	✓	✓	✓
CPU47	✓	✓	✓	✓	✓	✓	✓	✓
DMA4	✓	✓	✓	✓	✓	✓	✓	✓
DMA7	✓	✓	✓	✓	✓	✓	✓	✓
DMA8	✓	✓	✓	✓	✓	✓	✓	✓
DMA10	✓	✓	✓	✓	✓	✓	✓	✓
FLASH33	✓	✓	✓	✓	✓	✓	✓	✓
FLASH34	✓	✓	✓	✓	✓	✓	✓	✓
FLASH35							✓	✓
FLASH37						✓	✓	✓
MPY1	✓	✓	✓	✓	✓	✓	✓	✓
PMP1	✓	✓	✓	✓	✓	✓	✓	✓
PMM9	✓	✓	✓	✓	✓	✓	✓	✓
PMM10						✓	✓	✓
PMM11	✓	✓	✓	✓	✓	✓	✓	✓
PMM12	✓	✓	✓	✓	✓	✓	✓	✓
PMM14	✓	✓	✓	✓	✓	✓	✓	✓
PMM15	✓	✓	✓	✓	✓	✓	✓	✓
PMM17						✓	✓	✓
PMM18	✓	✓	✓	✓	✓	✓	✓	✓
PMM20	✓	✓	✓	✓	✓	✓	✓	✓
PORT15	✓	✓	✓	✓	✓	✓	✓	✓
PORT16	✓	✓	✓	✓	✓	✓	✓	✓
PORT19	✓	✓	✓	✓	✓	✓	✓	✓
RTC3	✓	✓	✓	✓	✓	✓	✓	✓
RTC6	✓	✓	✓	✓	✓	✓	✓	✓

Errata Number	Rev K	Rev I	Rev H	Rev G	Rev F	Rev E	Rev D	Rev C
<a href="#">SYS10</a>						✓	✓	✓
<a href="#">SYS12</a>						✓	✓	✓
<a href="#">SYS16</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">SYS18</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">TAB23</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">UCS6</a>				✓	✓	✓	✓	✓
<a href="#">UCS7</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">UCS9</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">UCS10</a>						✓	✓	✓
<a href="#">UCS11</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">USB4</a>						✓	✓	✓
<a href="#">USB6</a>						✓	✓	✓
<a href="#">USB8</a>						✓	✓	✓
<a href="#">USB9</a>				✓	✓	✓	✓	✓
<a href="#">USB10</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">USB11</a>		✓						
<a href="#">USB12</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">USB13</a>		✓						
<a href="#">USCI26</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">USCI30</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">USCI31</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">USCI34</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">USCI35</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">USCI39</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">USCI40</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">WDG4</a>	✓	✓	✓	✓	✓	✓	✓	✓

## 2 Preprogrammed Software Errata Revision History

Errata impacting pre-programmed software into the silicon by Texas Instruments.

✓ The check mark indicates that the issue is present in the specified revision.

Errata Number	Rev K	Rev I	Rev H	Rev G	Rev F	Rev E	Rev D	Rev C
<a href="#">BSL6</a>			✓	✓	✓			
<a href="#">BSL7</a>		✓	✓	✓	✓	✓	✓	✓
<a href="#">JTAG20</a>	✓	✓	✓	✓	✓	✓	✓	✓

## 3 Debug only Errata Revision History

Errata only impacting debug operation.

✓ The check mark indicates that the issue is present in the specified revision.

Errata Number	Rev K	Rev I	Rev H	Rev G	Rev F	Rev E	Rev D	Rev C
<a href="#">EEM9</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">EEM11</a>	✓	✓	✓	✓	✓	✓	✓	✓

Errata Number	Rev K	Rev I	Rev H	Rev G	Rev F	Rev E	Rev D	Rev C
<a href="#">EEM13</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">EEM14</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">EEM15</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">EEM16</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">EEM17</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">EEM19</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">EEM21</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">EEM23</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">JTAG26</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">JTAG27</a>	✓	✓	✓	✓	✓	✓	✓	✓

#### 4 Fixed by Compiler Errata Revision History

Errata completely resolved by compiler workaround. Refer to specific erratum for IDE and compiler versions with workaround.

✓ The check mark indicates that the issue is present in the specified revision.

Errata Number	Rev K	Rev I	Rev H	Rev G	Rev F	Rev E	Rev D	Rev C
<a href="#">CPU21</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU22</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU23</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU26</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU27</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU28</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU29</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU30</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU31</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU32</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU33</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU34</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU35</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU39</a>	✓	✓	✓	✓	✓	✓	✓	✓
<a href="#">CPU40</a>	✓	✓	✓	✓	✓	✓	✓	✓

Refer to the following MSP430 compiler documentation for more details about the CPU bugs workarounds.

##### TI MSP430 Compiler Tools (Code Composer Studio IDE)

- [MSP430 Optimizing C/C++ Compiler](#): Check the --silicon\_errata option
- [MSP430 Assembly Language Tools](#)

##### MSP430 GNU Compiler (MSP430-GCC)

- [MSP430 GCC Options](#): Check -msilicon-errata= and -msilicon-errata-warn= options
- [MSP430 GCC User's Guide](#)


##### IAR Embedded Workbench

- [IAR workarounds for msp430 hardware issues](#)


## 5 Package Markings

### PN80

#### LQFP (PN), 80 Pin

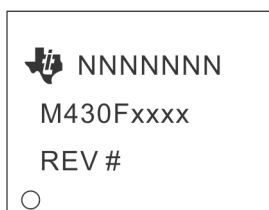

# = Die revision  
 ○ = Pin 1 location  
 N = Lot trace code

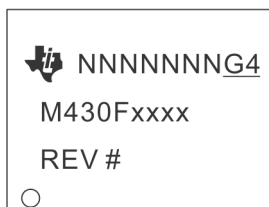

# = Die revision  
 ○ = Pin 1 location  
 N = Lot trace code

## 6 Memory-Mapped Hardware Revision (TLV Structure)

Die Revision	TLV Hardware Revision
Rev K	19h
Rev I	18h
Rev H	17h
Rev G	16h
Rev F	15h
Rev E	14h
Rev D	13h
Rev C	12h

Further guidance on how to locate the TLV structure and read out the HW\_ID can be found in the device User's Guide.

## 7 Detailed Bug Description

<b>ADC25</b>	<b><i>ADC12_A Module</i></b>
<b>Category</b>	Functional
<b>Function</b>	Write to ADC12CTL0 triggers ADC12 when CONSEQ = 00
<b>Description</b>	If ADC conversions are triggered by the Timer_B module and the ADC12 is in single-channel single-conversion mode (CONSEQ = 00), ADC sampling is enabled by write access to any bit(s) in the ADC12CTL0 register. This is contrary to the expected behavior that only the ADC12 enable conversion bit (ADC12ENC) triggers a new ADC12 sample.
<b>Workaround</b>	When operating the ADC12 in CONSEQ=00 and a Timer_B output is selected as the sample and hold source, temporarily clear the ADC12ENC bit before writing to other bits in the ADC12CTL0 register. The following capture trigger can then be re-enabled by setting ADC12ENC = 1.
<b>ADC27</b>	<b><i>ADC12_A Module</i></b>
<b>Category</b>	Functional
<b>Function</b>	Integral and differential non-linearity exceed specifications
<b>Description</b>	<p>The ADC12_A integral and differential non-linearity may exceed the limits specified in the data sheet under the following conditions:</p> <ul style="list-style-type: none"> <li>- If the internal voltage reference generator is used</li> <li>and</li> <li>- If the reference voltage is not buffered off-chip</li> <li>and</li> <li>- If <math>f_{ADC12CLK} &gt; 2.7</math> MHz</li> </ul> <p>The non-linearity can be up to tens of LSBs. This is due to the internal reference buffer providing insufficient drive for the switched capacitor array of the ADC12_A.</p>
<b>Workaround</b>	<p>(1) Turn on the output of the internal voltage reference to increase the drive strength of the reference to the ADC_12 core:</p> <ul style="list-style-type: none"> <li>- If REFMSTR bit in REFCTL0 is 0 (allowing Shared REF to be controlled by ADC_A reference control bits)</li> </ul> <p>Set ADC12REFON bit in ADC12CTL0 = 1</p> <p>and</p> <p>Set ADC12REFOUT bit in ADC12CTL2 = 1</p> <ul style="list-style-type: none"> <li>- If REFMSTR bit in REFCTL0 is 1</li> </ul> <p>Set REFON and REFOUT bits in REFCTL0 = 1</p> <p>(2) Ensure <math>f_{ADC12CLK} &lt; 2.7</math> MHz. Depending on the frequency of the source of <math>f_{ADC12CLK}</math> (ACLK, MCLK, SMCLK, or MODOSC), select the divider bits accordingly.</p> <ul style="list-style-type: none"> <li>- If <math>f_{ADC12CLK} = MODOSC</math></li> </ul> <p>(ADC12OSC) ADC12CTL1  = ADC12DIV_1; // Divide clock by 2</p> <ul style="list-style-type: none"> <li>- If <math>f_{ADC12CLK} = ACLK/SMCLK/MCLK &gt; 2.7</math> MHz.</li> </ul>

Use ADC12DIVx and/or ADC12PDIVx bits to reduce the selected clock frequency to between 0.45 MHz and 2.7 MHz.

**ADC29**
***ADC12\_A Module***


---

**Category**

Functional

**Function**

Incorrect temperature sensor calibration data

**Description**

In some devices, the internal temperature sensor calibration data for 30 degC are invalid for all VRef conditions. Devices with correct calibration data show a difference of at least 30 LSBs between the different VRef conditions. When using incorrect calibration data with the internal temperature sensor ADC samples, the calculated results can be unreliable. Calibration data for 85 degC are not affected.

MSP430F552x/551x/532x/524x silicon revision E devices with the lot trace code beyond 0BCVXPK are not affected by this erratum.

**Workaround**

Recalibrate the temperature sensor for 30 degC at the application level.

**ADC42**
***ADC12\_A Module***


---

**Category**

Functional

**Function**

ADC stops converting when successive ADC is triggered before the previous conversion ends

**Description**

Subsequent ADC conversions are halted if a new ADC conversion is triggered while ADC is busy. ADC conversions are triggered manually or by a timer. The affected ADC modes are:

- sequence-of-channels
- repeat-single-channel
- repeat-sequence-of-channels (ADC12CTL1.ADC12CONSEQx)

In addition, the timer overflow flag cannot be used to detect an overflow (ADC12IFGR2.ADC12TOVIFG).

**Workaround**

1. For manual trigger mode (ADC12CTL0.ADC12SC), ensure each ADC conversion is completed by first checking ADC12CTL1.ADC12BUSY bit before starting a new conversion.

2. For timer trigger mode (ADC12CTL1.ADC12SHP), ensure the timer period is greater than the ADC sample and conversion time.

To recover the conversion halt:

1. Disable ADC module (ADC12CTL0.ADC12ENC = 0 and ADC12CTL0.ADC12ON = 0)
2. Re-enable ADC module (ADC12CTL0.ADC12ON = 1 and ADC12CTL0.ADC12ENC = 1)
3. Re-enable conversion

**ADC69**
***ADC12\_A Module***


---

**Category**

Functional

<b>Function</b>	ADC stops operating if ADC clock source is changed from SMCLK to another source while SMCLKOFF = 1.
<b>Description</b>	When SMCLK is used as the clock source for the ADC (ADC12CTL1.ADC12SSELx = 11) and CSCTL4.SMCLKOFF = 1, the ADC will stop operating if the ADC clock source is changed by user software (e.g. in the ISR) from SMCLK to a different clock source. This issue appears only for the ADC12CTL1.ADC12DIVx settings /3/5/7. The hang state can be recovered by PUC/POR/BOR/Power cycle.
<b>Workaround</b>	1. Set CSCTL4.SMCLKOFF = 0 before switch ADC clock source. OR 2. Only use ADC12CTL1.ADC12DIVx as /1, /2, /4, /6, /8

---

**BSL6** ***BSL Module***


---

<b>Category</b>	Software in ROM
<b>Function</b>	USB BSL does not respond properly to suspend/reset events from the USB host
<b>Description</b>	<p>The USB BSL in affected revisions contains an improper configuration of the USB module. As a result, errors might occur in response to suspend/reset events from the USB host. (Since enumeration of the USB device often involves suspend and/or reset events, an enumeration might trigger the failure.) If the failure occurs, the device becomes unresponsive to the USB host.</p> <p>If the failure occurs, and if application code exists in main flash, a reset (BOR/POR/PUC) can be issued to switch execution away from the BSL, to the application. Given the same USB host/setup circumstances, the problem is likely to occur again on subsequent attempts.</p> <p>Applications that do not use the USB BSL are unaffected.</p>
<b>Workaround</b>	1. The BSL can be updated via JTAG with a version that does not contain this bug. Use the code published in <a href="http://www.ti.com/lit/pdf/slaa450">www.ti.com/lit/pdf/slaa450</a> >BSL documentation</a> starting with version 00.07.85.36.

---

**BSL7** ***BSL Module***


---

<b>Category</b>	Software in ROM
<b>Function</b>	BSL does not start after waking up from LPMx.5
<b>Description</b>	When waking up from LPMx.5 mode, the BSL does not start as it does not clear the Lock I/O bit (LOCKLPM5 bit in PM5CTL0 register) on start-up.
<b>Workaround</b>	1. Upgrade the device BSL to the latest version (see Creating a Custom Flash-Based Bootstrap Loader (BSL) Application Note - SLAA450 for more details) OR 2. Do not use LOCKLPM5 bit (LPMx.5) if the BSL is used but cannot be upgraded.

---

**COMP10** ***COMP\_B Module***


---

<b>Category</b>	Functional
<b>Function</b>	Comparator port output toggles when entering or leaving LPM3/LPM4
<b>Description</b>	The comparator port pin output (CECTL1.CEOUT) erroneously toggles when device enters or leaves LPM3/LPM4 modes under the following conditions:

- 1) Comparator is disabled (CECTL1.CEON = 0)  
AND
- 2) Output polarity is enabled (CECTL1.CEOUTPOL = 1)  
AND
- 3) The port pin is configured to have CEOUT functionality.

For example, if the CEOUT pin is high when the device is in Active Mode, CEOUT pin becomes low when the device enters LPM3/LPM4 modes.

**Workaround**

When the comparator is disabled, ensure at least one of the following:

- 1) Output inversion is disabled (CECTL.CEOUTPOL = 0)  
OR
- 2) Change pin configuration from CEOUT to GPIO with output low.

**CPU21**
***CPUXv2 Module***
**Category**

Compiler-Fixed

**Function**

Using POPM instruction on Status register may result in device hang up

**Description**

When an active interrupt service request is pending and the POPM instruction is used to set the Status Register (SR) and initiate entry into a low power mode, the device may hang up.

**Workaround**

None. It is recommended not to use POPM instruction on the Status Register.  
Refer to the table below for compiler-specific fix implementation information.

IDE/Compiler	Version Number	Notes
IAR Embedded Workbench	Not affected	
TI MSP430 Compiler Tools (Code Composer Studio)	v4.0.x or later	User is required to add the compiler or assembler flag option below. --silicon_errata=CPU21
MSP430 GNU Compiler (MSP430-GCC)	MSP430-GCC 4.9 build 167 or later	

**CPU22**
***CPUXv2 Module***
**Category**

Compiler-Fixed

**Function**

Indirect addressing mode with the Program Counter as the source register may produce unexpected results

**Description**

When using the indirect addressing mode in an instruction with the Program Counter (PC) as the source operand, the instruction that follows immediately does not get executed.

For example in the code below, the ADD instruction does not get executed.

```
mov @PC, R7
add #1h, R4
```

**Workaround**

Refer to the table below for compiler-specific fix implementation information.



IDE/Compiler	Version Number	Notes
IAR Embedded Workbench	Not affected	
TI MSP430 Compiler Tools (Code Composer Studio)	v4.0.x or later	User is required to add the compiler or assembler flag option below. --silicon_errata=CPU22
MSP430 GNU Compiler (MSP430-GCC)	MSP430-GCC 4.9 build 167 or later	

**CPU23**
***CPUXv2 Module***
**Category**

Compiler-Fixed

**Function**

Rotate instruction does not function as expected

**Description**

When repeated rotate instructions (rrcm, rram, rrum and rlam) are applied on the Program Counter(PC), unexpected instruction execution may occur.

**Workaround**

Insert a NOP instruction between sequential rotate instructions performed on the PC register.

Refer to the table below for compiler-specific fix implementation information.

IDE/Compiler	Version Number	Notes
IAR Embedded Workbench	Not affected	
TI MSP430 Compiler Tools (Code Composer Studio)	v4.0.x or later	User is required to add the compiler or assembler flag option below. --silicon_errata=CPU23
MSP430 GNU Compiler (MSP430-GCC)	MSP430-GCC 4.9 build 167 or later	

**CPU26**
***CPUXv2 Module***
**Category**

Compiler-Fixed

**Function**

CALL SP instruction does not behave as expected

**Description**

The intention of the CALL SP instruction is to execute code from the stack, instead it skips the first piece of data (instruction) on the stack. The second piece of data at SP+2 is used as the first executable instruction.

**Workaround**

Write the op code for a NOP as the first instruction on the stack. Begin the intended subroutine at address SP + 2.

Refer to the table below for compiler-specific fix implementation information.

IDE/Compiler	Version Number
IAR Embedded Workbench	Not affected
TI MSP430 Compiler Tools (Code Composer Studio)	v4.1.3 or later
MSP430 GNU Compiler (MSP430-GCC)	Not affected

**CPU27**
***CPUXv2 Module***
**Category**

Compiler-Fixed

**Function**

Program Counter (PC) is corrupted during the context save of a nested interrupt

**Description** When a low power mode is entered within an interrupt service routine that has enabled nested interrupts (by setting the GIE bit), and the instruction that sets the low power mode is directly followed by a RETI instruction, an incorrect value of PC + 2 is pushed to the stack during the context save. Hence, the RETI instruction is not executed on return from the nested interrupt and the PC becomes corrupted.

**Workaround** Insert a NOP or `__no_operation()` intrinsic function between the instruction that sets the lower power mode and the RETI instruction.

Refer to the table below for compiler-specific fix implementation information.

IDE/Compiler	Version Number	Notes
IAR Embedded Workbench	IAR EW430 v6.20 until v6.40	User is required to add the compiler or assembler flag option below. --hw_workaround=nop_after_lpm
IAR Embedded Workbench	IAR EW430 v6.40 or later	Workaround is automatically enabled
TI MSP430 Compiler Tools (Code Composer Studio)	v4.1.3 or later	
MSP430 GNU Compiler (MSP430-GCC)	MSP430-GCC 4.9 build 167	

## CPU28

### *CPUXv2 Module*

**Category** Compiler-Fixed

**Function** PC is corrupted when using certain extended addressing mode combinations

**Description** An extended memory instruction that modifies the program counter executes incorrectly when preceded by an extended memory write-back instruction under the following conditions:

First instruction:

2-operand instruction, extended mode using (register,index), (register,absolute), OR (register,symbolic) addressing modes

Second instruction:

2-operand instruction, extended mode using the (indirect,PC), (indirect auto-increment,PC), OR (indexed [with ind 0], PC) addressing modes

Example:

BISX.A R6,&AABCD

ANDX.A @R4+,PC

**Workaround** 1. Insert a NOP or a `__no_operation()` intrinsic function between the two instructions

Or

2. Do not use an extended memory instruction to modify the PC

Refer to the table below for compiler-specific fix implementation information.

IDE/Compiler	Version Number
IAR Embedded Workbench	Not affected
TI MSP430 Compiler Tools (Code Composer Studio)	v4.1.3 or later
MSP430 GNU Compiler (MSP430-GCC)	Not affected

**CPU29** *CPUXv2 Module*
**Category** Compiler-Fixed

**Function** Using a certain instruction sequence to enter low power mode(s) affects the instruction width of the first instruction in an NMI ISR

**Description** If there is a pending NMI request when the CPU enters a low power mode (LPMx) using an instruction of Indexed source addressing mode, and that instruction is followed by a 20-bit wide instruction of Register source and destination addressing modes, the first instruction of the ISR is executed as a 20-bit wide instruction.

Example:

```
main:
```

```
...
```

```
MOV.W [indexed],SR ; Enter LPMx
```

```
MOVX.A [register],[register] ; 20-bit wide instruction
```

```
...
```

```
ISR_start:
```

```
MOV.B [indexed],[register] ; ERROR - Executed as a 20-bit instruction!
```

Note: [] indicates addressing mode

**Workaround**

1. Insert a NOP or a `__no_operation()` intrinsic function following the instruction that enters the LPMx using indexed addressing mode

OR

2. Use a NOP or a `__no_operation()` intrinsic function as first instruction in the ISR

OR

3. Do not use the indexed mode to enter LPMx

Refer to the table below for compiler-specific fix implementation information.

IDE/Compiler	Version Number	Notes
IAR Embedded Workbench	IAR EW430 v6.20 until v6.40	User is required to add the compiler or assembler flag option below. --hw_workaround=nop_after_lpm
IAR Embedded Workbench	IAR EW430 v6.40 or later	Workaround is automatically enabled
TI MSP430 Compiler Tools (Code Composer Studio)	v4.1.3 or later	
MSP430 GNU Compiler (MSP430-GCC)	MSP430-GCC 4.9 build 167	

**CPU30** *CPUXv2 Module*
**Category** Compiler-Fixed

**Function** ADDA, SUBA, CMPA [immediate],PC behave as if immediate value were offset by -2

**Description** The extended address instructions ADDA, SUBA, CMPA in immediate addressing mode are represented by 4-bytes of opcode (see the MSP430F5xx Family User's Guide [MSP430F5xx Family User's Guide](#) for more details). In cases where the program counter (PC) is used as the destination register only 2 bytes of the current instruction's 4-byte

opcode are accounted for in the PC value. The resulting operation executes as if the immediate value were offset by a value of -2.

Ideal: ADDA #Immediate-4, PC

...is equivalent to...

Actual: ADDA #Immediate-2, PC

\*\* NOTE: The MOV instruction is not affected \*\*

**Workaround**

1) Modify immediate value in software to account for the offset of 2.

OR

2) Use extended 20-bit instructions (addx.a, subx.a, cmpx.a).

Refer to the table below for compiler-specific fix implementation information.

IDE/Compiler	Version Number	Notes
IAR Embedded Workbench	IAR EW430 v5.30 or later	IDE-based usage enables the workaround automatically. When using the command line, user is required to add the option below: Linker: -D?CPU30_OFFSET=2
TI MSP430 Compiler Tools (Code Composer Studio)	v4.0 or later	
MSP430 GNU Compiler (MSP430-GCC)	Not affected	

**CPU31**

**CPUXv2 Module**

**Category**

Compiler-Fixed

**Function**

SP corruption

**Description**

When the instruction PUSHX.A is executed using the indirect auto-increment mode with the stack pointer (SP) as the source register [PUSHX.A @SP+] the SP is consequently corrupted. Instead of decrementing the value of the SP by four, the value of the SP is replaced with the data pointed to by the SP previous to the PUSHX.A instruction execution.

**Workaround**

None. Note that compilers will not generate a PUSHX.A instruction that involves the SP.

Refer to the table below for compiler-specific information.

IDE/Compiler	Version Number
IAR Embedded Workbench	Not affected
TI MSP430 Compiler Tools (Code Composer Studio)	Not affected
MSP430 GNU Compiler (MSP430-GCC)	Not affected

**CPU32**

**CPUXv2 Module**

**Category**

Compiler-Fixed

**Function**

CALLA PC executes incorrectly

**Description**

When the instruction CALLA PC is executed, the program counter (PC) that is pushed onto the stack during the context save is incorrectly offset by a value of -2.

**Workaround** None. Note that compilers will not generate a CALLA PC instruction.  
Refer to the table below for compiler-specific information.

IDE/Compiler	Version Number
IAR Embedded Workbench	Not affected
TI MSP430 Compiler Tools (Code Composer Studio)	Not affected
MSP430 GNU Compiler (MSP430-GCC)	Not affected

### **CPU33** *CPUXv2 Module*

**Category** Compiler-Fixed

**Function** CALLA [indexed] may corrupt the program counter

**Description** When the Stack Pointer (SP) is used as the destination register in the CALLA index(Rdst) instruction and is preceded by a PUSH or PUSHX instruction in any of the following addressing modes: Absolute, Symbolic, Indexed, Indirect register or Indirect auto increment, the "index" of the CALLA instruction is not sign extended to 20-bits and is always treated as a positive value. This causes the Program Counter to be set to a wrong address location when the index of the CALLA instruction represents a negative offset.

NOTE:

1. This erratum only applies when the instruction sequence is: PUSH or PUSHX followed by CALLA index(SP)
2. This erratum does not apply if the PUSH or PUSHX instruction is used in the Register or Immediate addressing mode
3. This erratum only applies when SP is used as the destination register in the CALLA index(Rdst) instruction

**Workaround** Place a "NOP" instruction in between the PUSH or PUSHX and the CALLA index(SP) instructions.

NOTE: This bug has no compiler impact as the compiler will not generate a CALLA instruction that uses indexed addressing mode with the SP.

Refer to the table below for compiler-specific information.

IDE/Compiler	Version Number
IAR Embedded Workbench	Not affected
TI MSP430 Compiler Tools (Code Composer Studio)	Not affected
MSP430 GNU Compiler (MSP430-GCC)	Not affected

### **CPU34** *CPUXv2 Module*

**Category** Compiler-Fixed

**Function** CPU may be halted if a conditional jump is followed by a rotate PC instruction

**Description** If a conditional jump instruction (JZ, JNZ, JC, JNC, JN, JGE, JL) is followed by an Address Rotate instruction on the PC (RRCM, RRAM, RLAM, RRUM) and the jump is not performed, the CPU is halted.

**Workaround** Insert a NOP between the conditional jump and the rotate PC instructions.

Refer to the table below for compiler-specific information.

IDE/Compiler	Version Number
IAR Embedded Workbench	Not affected
TI MSP430 Compiler Tools (Code Composer Studio)	Not affected
MSP430 GNU Compiler (MSP430-GCC)	Not affected

## CPU35

### *CPUXv2 Module*

#### Category

Compiler-Fixed

#### Function

Instruction BIT.B @Rx,PC uses the wrong PC value

#### Description

The BIT(.B/.W) instruction in indirect register addressing mode uses the wrong PC value. This instruction is represented by 2 bytes of opcode. If the Program Counter (PC) is used as the destination register, the 2 opcode bytes of the current BIT instruction are not accounted for. The resulting operation executes the instruction using the wrong PC value and this affects the results in the Status Register (SR).

#### Workaround

None. Note that compilers will not generate a BIT instruction that uses the PC as an operand.

Refer to the table below for compiler-specific information.

IDE/Compiler	Version Number
IAR Embedded Workbench	Not affected
TI MSP430 Compiler Tools (Code Composer Studio)	Not affected
MSP430 GNU Compiler (MSP430-GCC)	Not affected

## CPU37

### *CPUXv2 Module*

#### Category

Functional

#### Function

Wrong program trace display in the debugger while using conditional jump instructions

#### Description

The state storage window displays an incorrect sequence of instructions when:

1. Conditional jump instructions are used to form a software loop

AND

2. A false condition on the jump breaks out of the loop

In such cases the trace buffer incorrectly displays the first instruction of the loop as the instruction that is executed immediately after exiting the loop.

Example:

Actual Code:

```
mov #4,R4
```

```
LABEL mov #1,R5
```

```
dec R4
```

```
jnz LABEL
```

```
mov #2,R6
```

```
nop
```

State Storage Window Displays:

```

LABEL mov #1,R5
dec R4
jnz LABEL
mov #1,R5
nop
    
```

**Workaround**

None

Note: This erratum affects the trace buffer display only. It does not affect code execution in debugger or free run mode

**CPU39**
***CPUXv2 Module***
**Category**

Compiler-Fixed

**Function**

PC is corrupted when single-stepping through an instruction that clears the GIE bit

**Description**

Single-stepping over an instruction that clears the General Interrupt Enable bit (for example DINT or BIC #GIE,SR) when the GIE bit was previously set may corrupt the PC. For example, the DINT or BIC #GIE,SR is a 2-byte instruction. Single stepping through this instruction increments the PC by a value of 4 instead of 2 thus corrupting the next PC value.

Note: This erratum applies to debug mode only.

**Workaround**

Insert a NOP or `__no_operation()` intrinsic immediately after the line of code that clears the GIE bit.

OR

Refer to the table below for compiler-specific fix implementation information.

Note that compilers implementing the fix may lead to double stack usage when RET/RETA follows the compiler-inserted NOP.

IDE/Compiler	Version Number	Notes
IAR Embedded Workbench	IAR EW430 v5.60 until v6.20	User is required to add the compiler flag option below. --hw_workaround=CPU39 For the command line version add the following information Compiler: --core=430 Assembler:-v1
IAR Embedded Workbench	IAR EW430 v6.20 or later	Workaround is automatically enabled
TI MSP430 Compiler Tools (Code Composer Studio)	v4.1.3 or later	
MSP430 GNU Compiler (MSP430-GCC)	MSP430-GCC 4.9 build 167 or later	

**CPU40**
***CPUXv2 Module***
**Category**

Compiler-Fixed

**Function**

PC is corrupted when executing jump/conditional jump instruction that is followed by instruction with PC as destination register or a data section

**Description** If the value at the memory location immediately following a jump/conditional jump instruction is 0X40h or 0X50h (where X = don't care), which could either be an instruction opcode (for instructions like RRCM, RRAM, RLAM, RRUM) with PC as destination register or a data section (const data in flash memory or data variable in RAM), then the PC value is auto-incremented by 2 after the jump instruction is executed; therefore, branching to a wrong address location in code and leading to wrong program execution.

For example, a conditional jump instruction followed by data section (0140h).

```
@0x8012 Loop DEC.W R6
@0x8014 DEC.W R7
@0x8016 JNZ Loop
@0x8018 Value1 DW 0140h
```

**Workaround** In assembly, insert a NOP between the jump/conditional jump instruction and program code with instruction that contains PC as destination register or the data section.

Refer to the table below for compiler-specific fix implementation information.

IDE/Compiler	Version Number	Notes
IAR Embedded Workbench	IAR EW430 v5.51 or later	For the command line version add the following information Compiler: --hw_workaround=CPU40 Assembler:-v1
TI MSP430 Compiler Tools (Code Composer Studio)	v4.0.x or later	User is required to add the compiler or assembler flag option below. --silicon_errata=CPU40
MSP430 GNU Compiler (MSP430-GCC)	Not affected	

## **CPU47** *CPUXv2 Module*

**Category** Functional

**Function** An unexpected Vacant Memory Access Flag (VMAIFG) can be triggered

**Description** An unexpected Vacant Memory Access Flag (VMAIFG) can be triggered, if a PC-modifying instruction (e.g. - ret, push, call, pop, jmp, br) is fetched from the last addresses (last 4 or 8 byte) of a memory (e.g.- FLASH, RAM, FRAM) that is not contiguous to a higher, valid section on the memory map.

In debug mode using breakpoints the last 8 bytes are affected.

In free running mode the last 4 bytes are affected.

**Workaround** Edit the linker command file to make the last 4 or 8 bytes of affected memory sections unavailable, to avoid PC-modifying instructions on these locations.

Remaining instructions or data can still be stored on these locations.

## **DMA4** *DMA Module*

**Category** Functional

**Function** Corrupted write access to 20-bit DMA registers



<b>Description</b>	When a 20-bit wide write to a DMA address register (DMAxSA or DMAxDA) is interrupted by a DMA transfer, the register contents may be unpredictable.
<b>Workaround</b>	<ol style="list-style-type: none"> <li>1. Design the application to guarantee that no DMA access interrupts 20-bit wide accesses to the DMA address registers.</li> </ol> <p>OR</p> <ol style="list-style-type: none"> <li>2. When accessing the DMA address registers, enable the Read Modify Write disable bit (DMARMWDIS = 1) or temporarily disable all active DMA channels (DMAEN = 0).</li> </ol> <p>OR</p> <ol style="list-style-type: none"> <li>3. Use word access for accessing the DMA address registers. Note that this limits the values that can be written to the address registers to 16-bit values (lower 64K of Flash).</li> </ol>

---

**DMA7** ***DMA Module***


---

<b>Category</b>	Functional
<b>Function</b>	DMA request may cause the loss of interrupts
<b>Description</b>	If a DMA request starts executing during the time when a module register containing an interrupt flags is accessed with a read-modify-write instruction, a newly arriving interrupt from the same module can get lost. An interrupt flag set prior to DMA execution would not be affected and remain set.
<b>Workaround</b>	<ol style="list-style-type: none"> <li>1. Use a read of Interrupt Vector registers to clear interrupt flags and do not use read-modify-write instruction.</li> </ol> <p>OR</p> <ol style="list-style-type: none"> <li>2. Disable all DMA channels during read-modify-write instruction of specific module registers containing interrupts flags while these interrupts are activated.</li> </ol>

---

**DMA8** ***DMA Module***


---

<b>Category</b>	Functional
<b>Function</b>	DMA can corrupt values on write-access to program stack
<b>Description</b>	<p>If the DMA controller makes a write access to the stack while executing one of the following instructions, the data that is written may be corrupted.</p> <p>CALLA [REG   IDX   SYM   ABS   IND   INA   IMM]          PUSHX.A [IDX   SYM   ABS   IND   IMM   INA]          PUSHX.A [REG]          PUSHM.A [REG]          POPM.A [REG]</p> <p>Note: [ ... ] denotes an addressing mode</p>
<b>Workaround</b>	Do not declare function-scope variables. Declare all variables that are intended to be modified by the DMA as global- or file-scope such that they are allocated in the data section of RAM and not on the program stack.

---

**DMA10** ***DMA Module***


---

<b>Category</b>	Functional
-----------------	------------

<b>Function</b>	DMA access may cause invalid module operation
<b>Description</b>	The peripheral modules MPY, CRC, USB, RF1A and FRAM controller in manual mode can stall the CPU by issuing wait states while in operation. If a DMA access to the module occurs while that module is issuing a wait state, the module may exhibit undefined behavior.
<b>Workaround</b>	Ensure that DMA accesses to the affected modules occur only when the modules are not in operation. For example with the MPY module, ensure that the MPY operation is completed before triggering a DMA access to the MPY module.
<b>EEM9</b>	<b><i>EEM Module</i></b>
<b>Category</b>	Debug
<b>Function</b>	Combined triggers on the PUSH instruction may be missed
<b>Description</b>	When the PUSH instruction is used in any addressing mode except register or immediate modes, a combined trigger may be missed when its conditions are defined by a PUSH instruction fetch and a successful match of the value being pushed onto stack.
<b>Workaround</b>	None
<b>EEM11</b>	<b><i>EEM Module</i></b>
<b>Category</b>	Debug
<b>Function</b>	Conditional register write trigger fails while executing rotate instructions
<b>Description</b>	A conditional register write trigger will fail to generate the expected breakpoint if the trigger condition is a result of executing one of the following rotate instructions: RRUM, RRCM, RRAM and RLAM.
<b>Workaround</b>	None
	<hr/> <b>NOTE:</b> This erratum applies to debug mode only. <hr/>
<b>EEM13</b>	<b><i>EEM Module</i></b>
<b>Category</b>	Debug
<b>Function</b>	Halting the debugger does not return correct PC value when in LPM
<b>Description</b>	When debugging, if the device is in any low power mode and the debugger is halted, the program counter update by the debugger is corrupted. The debugger is unable to halt at the correct location.
<b>Workaround</b>	None.
	<hr/> <b>NOTE:</b> This erratum applies to debug mode only. <hr/>
<b>EEM14</b>	<b><i>EEM Module</i></b>

**Category** Debug

**Function** Single-step or breakpoint on module registers with WAIT capability may not work

**Description** In debug mode, the CPU clock is driven independently from the wait inputs of device modules (i.e., MULT, USB, RF1A, CRC). As a result, an EEM halt on an access to the module data registers (breakpoint or single-step) may show incorrect results due to incomplete execution.

**Workaround** Do not single-step through a data register access that holds the CPU to provide a valid result. Place breakpoints after the affected register is accessed and sufficient clock cycles have been provided.

---

**NOTE:** This erratum applies to debug mode only.

---

### **EEM15** *EEM Module*

---

**Category** Debug

**Function** Read or write to RF1A, CRC, MULT and USB RAM may be corrupted when debugging

**Description** When performing read or write operations on modules that require CPU wait cycles (i.e. when accessing CRC, RF1A, MULT and USB RAM) setting a breakpoint on or single stepping through the operation could corrupt the result.

**Workaround** None

---

**NOTE:** This erratum applies to debug mode only.

---

### **EEM16** *EEM Module*

---

**Category** Debug

**Function** The state storage display does not work reliably when used on instructions with CPU Wait cycles.

**Description** When executing instructions that require wait states; the state storage window updates incorrectly. For example a flash erase instruction causes the CPU to be held until the erase is completed i.e. the flash puts the CPU in a wait state. During this time if the state storage window is enabled it may incorrectly display any previously executed instruction multiple times.

**Workaround** Do not enable the state storage display when executing instructions that require wait states. Instead set a breakpoint after the instruction is completed to view the state storage display.

---

**NOTE:** This erratum affects debug mode only.

---

### **EEM17** *EEM Module*

---

<b>Category</b>	Debug
<b>Function</b>	Wrong Breakpoint halt after executing Flash Erase/Write instructions
<b>Description</b>	Hardware breakpoints or Conditional Address triggered breakpoints on instructions that follow Flash Erase/Write instructions, stops the debugger at the actual Flash Erase/Write instruction even though the flash erase/write operation has already been executed. The hardware/conditional address triggered breakpoints that are placed on either the next two single opcode instructions OR the next double opcode instruction that follows the Flash Erase/Write instruction are affected by this erratum.
<b>Workaround</b>	None. Use other conditional/advanced triggered breakpoints to halt the debugger right after Flash erase/write instructions.

---

**NOTE:** This erratum affects debug mode only.

---

### **EEM19** *EEM Module*

---

<b>Category</b>	Debug
<b>Function</b>	DMA may corrupt data in debug mode
<b>Description</b>	When the DMA is enabled and the device is in debug mode, the data written by the DMA may be corrupted when a breakpoint is hit or when the debug session is halted.
<b>Workaround</b>	This erratum has been addressed in MSPDebugStack version 3.5.0.1. It is also available in released IDE EW430 IAR version 6.30.3 and CCS version 6.1.1 or newer. If using an earlier version of either IDE or MSPDebugStack, do not halt or use breakpoints during a DMA transfer.

---

**NOTE:** This erratum applies to debug mode only.

---

### **EEM21** *EEM Module*

---

<b>Category</b>	Debug
<b>Function</b>	LPMx.5 debug limitations
<b>Description</b>	Debugging the device in LPMx.5 mode might wake the device up from LPMx.5 mode inadvertently, and it is possible that the device enters a lock-up condition; that is, the device cannot be accessed by the debugger any more.
<b>Workaround</b>	Follow the debugging steps in Debugging MSP430 LPM4.5 <a href="#">SLAA424</a> .

### **EEM23** *EEM Module*

---

<b>Category</b>	Debug
<b>Function</b>	EEM triggers incorrectly when modules using wait states are enabled
<b>Description</b>	When modules using wait states (USB, MPY, CRC and FRAM controller in manual mode) are enabled, the EEM may trigger incorrectly. This can lead to an incorrect profile counter value or cause issues with the EEMs data watch point, state storage, and

breakpoint functionality.

**Workaround** None.

---

**NOTE:** This erratum affects debug mode only.

---

### **FLASH33**

#### ***FLASH Module***

---

**Category**

Functional

**Function**

Flash erase/program with fsystem <160kHz causes code execution to fail

**Description**

A flash erase or flash program operation with the system frequency (fsystem) <160kHz causes the program execution (executing out of main or info memory) that follows to fail.

**Workaround**

Make sure the fsystem >160kHz before doing a flash erase or program operation.

### **FLASH34**

#### ***FLASH Module***

---

**Category**

Functional

**Function**

Concurrent flash read during bank erase fails

**Description**

Code residing in flash cannot be executed during a bank erase.

**Workaround**

Place the code to be executed during bank erase in RAM.

### **FLASH35**

#### ***FLASH Module***

---

**Category**

Functional

**Function**

Flash read error may cause invalid memory access

**Description**

Flash memory accesses are always 32-bit wide and performed on 32-bit boundaries. A read error when accessing flash may corrupt the second most significant bit (MSB-1) in a 32-bit access when programmed as a logic 0.

When affected flash is idle, the read disturb may occur on the first flash access that follows any of the listed events:

- On reset issued at RST input pin
- On wakeup from low-power modes when executing interrupt service routines located at addresses <0xC400
- When moving program execution from unaffected to affected areas of flash
- When accessing affected flash after execution from RAM

**Workaround**

See Flash Read Error and Susceptibility for MSP430F55xx ([SLAA471](#)) for detailed background information and possible workaround(s).

### **FLASH37**

#### ***FLASH Module***

---


**Category**

Functional

<b>Function</b>	Corrupted flash read when SVM low-side flag is triggered
<b>Description</b>	<p>If the SVM low side is enabled, a change in the VCORE voltage level (an increase in the VCORE level) may cause the currently executed read operation from flash to be incorrect and may lead to unexpected code execution or incorrect data. This can happen under any one of the following conditions:</p> <ul style="list-style-type: none"> <li>- When the VCORE is changed in application, the SVM low side is used to indicate if the core voltage has settled by using the SVMDLYIFG flag. The failure occurs only when a flash access is concurrent to the expiration of the settling time delay.</li> <li>- Unexpected changes in the VCORE voltage level</li> </ul> <p>For code examples and detailed guidance on the PMM operation and software APIs for PMM configuration see the driverlib APIs from 430Ware (<a href="#">MSP430Ware</a>).</p>
<b>Workaround</b>	<ul style="list-style-type: none"> <li>- Execute the procedure to change the VCORE level from RAM.</li> </ul> <p>or</p> <ul style="list-style-type: none"> <li>- If executing from flash, follow the procedure below when increasing the VCORE level. Note: To apply this workaround, the SVM low-side comparator must operate in normal mode (SVMLFP = 0 in SVMLCTL).</li> </ul> <pre>// Set SVM highside to new level and check if a VCore increase is possible SVSMHCTL = SVMHE   SVSHE   (SVSMHRRLO * level); // Wait until SVM highside is settled while ((PMMIFG &amp; SVSMHDLYIFG) == 0); // Clear flag PMMIFG &amp;= ~SVSMHDLYIFG; // Set also SVS highside to new level // Vcc is high enough for a Vcore increase SVSMHCTL  = (SVSHRVL0 * level); // Wait until SVM highside is settled while ((PMMIFG &amp; SVSMHDLYIFG) == 0); // Clear flag PMMIFG &amp;= ~SVSMHDLYIFG;  //*****flow change for errata workaround ***** // Set VCore to new level PMMCTL0_L = PMMCOREV0 * level;  // Set SVM, SVS low side to new level SVSMLCTL = SVMLE   (SVSMLRRL0 * level)   SVSLE   (SVSLRVL0 * level); // Wait until SVM, SVS low side is settled while ((PMMIFG &amp; SVSMLDLYIFG) == 0); // Clear flag PMMIFG &amp;= ~SVSMLDLYIFG; //*****flow change for errata workaround *****</pre>

**JTAG20**
**JTAG Module**

<b>Category</b>	Software in ROM
<b>Function</b>	BSL does not exit to application code
<b>Description</b>	The methods used to exit the BSL per MSP430 Programming Via the Bootstrap Loader (SLAU319) are invalid.
<b>Workaround</b>	To exit the BSL one of the following methods must be used. - A Power cycle or - Toggle the TEST pin twice when nRST is high and after 50us pull nRST low.

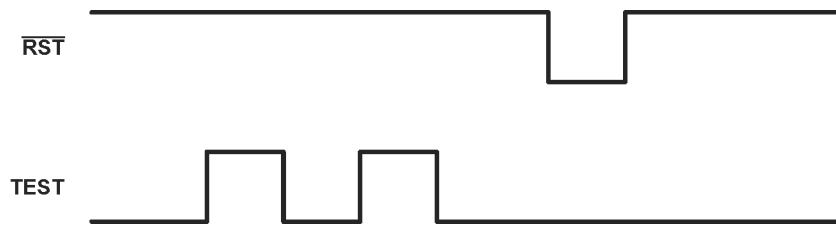

Note: This toggling of TEST pins is not subject to timing constraints. The appropriate level transitions on TEST pin, followed by a RST pulse after 50us, are sufficient to trigger an exit from BSL mode.

## JTAG26

### **JTAG Module**

<b>Category</b>	Debug
<b>Function</b>	LPMx.5 Debug Support Limitations
<b>Description</b>	<p>The JTAG connection to the device might fail at device-dependent low or high supply voltage levels if the LPMx.5 debug support feature is enabled. To avoid a potentially unreliable debug session or general issues with JTAG device connectivity and the resulting bad customer experience Texas Instruments has chosen to remove the LPMx.5 debug support feature from common MSP430 IDEs including TIs Code Composer Studio 6.1.0 with msp430.emu updated to version 6.1.0.7 and IARs Embedded Workbench 6.30.2, which are based on the MSP430 debug stack MSP430.DLL 3.5.0.1 <a href="http://www.ti.com/tool/MSPDS">http://www.ti.com/tool/MSPDS</a></p> <p>TI plans to re-introduce this feature in limited capacity in a future release of the debug stack by providing an IDE override option for customers to selectively re-activate LPMx.5 debug support if needed. Note that the limitations and supply voltage dependencies outlined in this erratum will continue to apply.</p> <p>For additional information on how the LPMx.5 debug support is handled within the MSP430 IDEs including possible workarounds on how to debug applications using LPMx.5 without toolchain support refer to <a href="#">Code Composer Studio User's Guide for MSP430 chapter F.4</a> and <a href="#">IAR Embedded Workbench User's Guide for MSP430 chapter 2.2.5</a>.</p>
<b>Workaround</b>	<ol style="list-style-type: none"> <li>1. If LPMx.5 debug support is deemed functional and required in a given scenario:             <ol style="list-style-type: none"> <li>a) Do not update the IDE to continue using a previous version of the debug stack such as MSP430.DLL v3.4.3.4.</li> </ol> <p>OR</p> <ol style="list-style-type: none"> <li>b) Roll back the debug stack by either performing a clean re-installation of a previous version of the IDE or by manually replacing the debug stack with a prior version such as MSP430.DLL v3.4.3.4 that can be obtained from <a href="http://www.ti.com/tool/MSPDS">http://www.ti.com/tool/MSPDS</a>.</li> </ol> </li> </ol>

2. In case JTAG connectivity fails during the LPMx.5 debug mode, the device supply voltage level needs to be raised or lowered until the connection is working.

Do not enable the LPMx.5 debug support feature during production programming.

**JTAG27**
**JTAG Module**


---

**Category**

Debug

**Function**

Unintentional code execution after programming via JTAG/SBW

**Description**

The device can unintentionally start executing code from uninitialized RAM addresses 0x0006 or 0x0008 after being programming via the JTAG or SBW interface. This can result in unpredictable behavior depending on the contents of the address location.

**Workaround**

1. If using programming tools purchased from TI (MSP-FET, LaunchPad), update to CCS version 6.1.3 later or IAR version 6.30 or later to resolve the issue.
2. If using the MSP-GANG Production Programmer, use v1.2.3.0 or later.
3. For custom programming solutions refer to the specification on MSP430 Programming Via the JTAG Interface User's Guide (SLAU320) revision V or newer and use MSPDebugStack v3.7.0.12 or later.

For MSPDebugStack (MSP430.DLL) in CCS or IAR, download the latest version of the development environment or the latest version of the [MSPDebugStack](#)

NOTE: This only affects debug mode.

**MPY1**
**MPY32 Module**


---

**Category**

Functional

**Function**

Save and Restore feature on MPY32 not functional

**Description**

The MPY32 module uses the Save and Restore method which involves saving the multiplier state by pushing the MPY configuration/operand values to the stack before using the multiplier inside an Interrupt Service Routine (ISR) and then restoring the state by popping the configuration/operand values back to the MPY registers at the end of the ISR. However due to the erratum the Save and Restore operation fails causing the write operation to the OP2H register right after the restore operation to be ignored as it is not preceded by a write to OP2L register resulting in an invalid multiply operation.

**Workaround**

None. Disable interrupts when writing to OP2L and OP2H registers.

Note: When using the C-compiler, the interrupts are automatically disabled while using the MPY32

**PMP1**
**PMP Module**


---

**Category**

Functional

**Function**

Port Mapping Controller does not clear unselected inputs to mapped module.

**Description**

The Port Mapping Controller provides the logical OR of all port mapped inputs to a module (Timer, USCI, etc). If the PSEL bit (PxSEL.y) of a port mapped input is cleared, then the logic level of that port mapped input is latched to the current logic level of the input. If the input is in a logical high state, then this high state is latched into the input of the logical OR. In this case, the input to the module is always a logical 1 regardless of the state of the selected input.



<b>Workaround</b>	<ol style="list-style-type: none"> <li>1. Drive input to the low state before clearing the PSEL bit of that input and switching to another input source.</li> <li>or</li> <li>2. Use the Port Mapping Controller reconfiguration feature, PMAPRECFG, to select inputs to a module and map only one input at a time.</li> </ol>
<b>PMM9</b>	<b><i>PMM Module</i></b>
<hr/>	
<b>Category</b>	Functional
<b>Function</b>	False SVSxIFG events
<b>Description</b>	<p>The comparators of the SVS require a certain amount of time to stabilize and output a correct result once re-enabled; this time is different for the Full Performance versus the Normal mode. The time to stabilize the SVS comparators is intended to be accounted for by a built-in event-masking delay of 2 us when Full Performance mode is enabled.</p> <p>However, the comparators of the SVS in Full Performance mode take longer than 2 us to stabilize so the possibility exists that a false positive will be triggered on the SVSH or SVSL. This results in the SVSxIFG flags being set and depending on the configuration of SVSxPE bit a POR can also be triggered.</p> <p>Additionally when the SVSxIFGs are set, all GPIOs are tri-stated i.e. floating until the SVSx comparators are settled.</p> <p>The SVS IFG's are falsely set under the following conditions:</p> <ol style="list-style-type: none"> <li>1. Wakeup from LPM2/3/4 when SVSxMD = 0 (default setting) &amp;&amp; SVSxFP=1. The SVSx comparators are disabled automatically in LPM2/3/4 and are then re-enabled on return to active mode.</li> <li>2. SVSx is turned on in full performance mode (SVSxFP=1).</li> <li>3. A PUC/POR occurs after SVSx is disabled. After a PUC or POR the SVSx are enabled automatically but the settling delay does not get triggered. Based on SVSxPE bit this may lead to POR events until the SVS comparator is fully settled.</li> </ol>
<b>Workaround</b>	<p>For each of the above listed conditions the following workarounds apply:</p> <ol style="list-style-type: none"> <li>1. If the Full Performance mode is to be enabled for either the high- or low-side SVS comparators, the respective SVSxMD bits must be set (SVSxMD = 1) such that the SVS comparators are not temporarily shut off in LPM2/3/4. Note that this is equivalent to a 2 uA (typical) adder to the low power mode current, per the device-specific datasheet, for each SVSx that remains enabled.</li> <li>2. The SVSx must be turned on in normal mode (SVSxFP=0). It can be reconfigured to use full performance mode once the SVSx/SVMx delay has expired.</li> <li>3. Ensure that SVSH and SVSL are always enabled.</li> </ol>
<b>PMM10</b>	<b><i>PMM Module</i></b>
<hr/>	
<b>Category</b>	Functional
<b>Function</b>	SVS/SVM flags disabled after Power Up Clear reset
<b>Description</b>	SVS/SVM interrupt flag functionality is disabled after a Power Up Clear (PUC) Reset if the SVS was disabled before the PUC reset was applied.
<b>Workaround</b>	A write access to the intended SVSx register after PUC re-enables the SVS & SVM interrupt flags.

<b>PMM11</b>	<b><i>PMM Module</i></b>
<b>Category</b>	Functional
<b>Function</b>	MCLK comes up fast on exit from LPM3 and LPM4
<b>Description</b>	The DCO exceeds the programmed frequency of operation on exit from LPM3 and LPM4 for up to 6 us. This behavior is masked from affecting code execution by default: SVSL and SVMML run in normal-performance mode and mask CPU execution for 150 us on wakeup from LPM3 and LPM4. However, when the low-side SVS and the SVM are disabled or are operating in full-performance mode (SVMLE = 0 and SVSLE = 0, or SVMMLFP = 1 and SVSLFP = 1) AND MCLK is sourced from the internal DCO running over 4 MHz, 7 MHz, 11 MHz, or 14 MHz at core voltage levels 0, 1, 2, and 3, respectively, the mask lasts only 2 us. MCLK is, therefore, susceptible to run out of spec for 4 us.
<b>Workaround</b>	Set the MCLK divide bits in the Unified Clock System Control 5 Register (UCSCTL5) to divide MCLK by two prior to entering LPM3 or LPM4 (set DIVMx = 001). This prevents MCLK from running out of spec when the CPU wakes from the low-power mode. Following the wakeup from the low-power mode, wait 32, 48, 80, or 100 cycles for core voltage levels 0, 1, 2, and 3, respectively, before resetting DIVMx to zero and running MCLK at full speed [for example, <code>__delay_cycles(100)</code> ].
<b>PMM12</b>	<b><i>PMM Module</i></b>
<b>Category</b>	Functional
<b>Function</b>	SMCLK comes up fast on exit from LPM3 and LPM4
<b>Description</b>	The DCO exceeds the programmed frequency of operation on exit from LPM3 and LPM4 for up to 6 us. When SMCLK is sourced by the DCO, it is not masked on exit from LPM3 or LPM4. Therefore, SMCLK exceeds the programmed frequency of operation on exit from LPM3 and LPM4 for up to 6 us. The increased frequency has the potential to change the expected timing behavior of peripherals that select SMCLK as the clock source.
<b>Workaround</b>	- Use XT2 as the SMCLK oscillator source instead of the DCO. or - Do not disable the clock request bit for SMCLKREQEN in the Unified Clock System Control 8 Register (UCSCTL8). This means that all modules that depend on SMCLK to operate successfully should be halted or disabled before entering LPM3 or LPM4. If the increased frequency prevents the proper function of an affected module, wait 32, 48, 80, or 100 cycles for core voltage levels 0, 1, 2, or 3, respectively, before re-enabling the module [for example, <code>__delay_cycles(100)</code> ].
<b>PMM14</b>	<b><i>PMM Module</i></b>
<b>Category</b>	Functional
<b>Function</b>	Increasing the core level when SVS/SVM low side is configured in full-performance mode causes device reset
<b>Description</b>	When the SVS/SVM low side is configured in full performance mode (SVSMMLCTL.SVSLFP = 1), the setting time delay for the SVS comparators is ~2us. When increasing the core level in full-performance mode; the core voltage does not settle to the new level before the settling time delay of the SVS/SVM comparator

expires. This results in a device reset.

**Workaround**

When increasing the core level; enable the SVS/SVM low side in normal mode (SVSMLCTL.SVSLFP=0). This provides a settling time delay of approximately 150us allowing the core sufficient time to increase to the expected voltage before the delay expires.

**PMM15**
**PMM Module**
**Category**

Functional

**Function**

Device may not wake up from LPM2, LPM3, or LPM4

**Description**

Device may not wake up from LPM2, LPM3 or LPM4 if an interrupt occurs within 1 us after the entry to the specified LPMx; entry can be caused either by user code or automatically (for example, after a previous ISR is completed). Device can be recovered with an external reset or a power cycle. Additionally, a PUC can also be used to reset the failing condition and bring the device back to normal operation (for example, a PUC caused by the WDT).

This effect is seen when:

- A write to the SVSMHCTL and SVSMLCTL registers is immediately followed by an LPM2, LPM3, LPM4 entry without waiting the requisite settling time ((PMMIFG.SVSMLDLYIFG = 0 and PMMIFG.SVSMHDLYIFG = 0)).

or

The following two conditions are met:

- The SVSL module is configured for a fast wake-up or when the SVSL/SVML module is turned off. The affected SVSMLCTL register settings are shaded in the following table.

	SVSLE	SVSLMD	SVSLFP	AM, LPM0/1 SVSL state	Manual SVSMLACE = 0	Automatic SVSMLACE = 1	Wakeup Time LPM2/3/4
					LPM2/3/4 SVSL State	LPM2/3/4 SVSL State	
SVSL	0	x	x	OFF	OFF	OFF	t <sub>WAKE-UP FAST</sub>
	1	0	0	Normal	OFF	OFF	t <sub>WAKE-UP SLOW</sub>
	1	0	1	Full Performance	OFF	OFF	t <sub>WAKE-UP FAST</sub>
	1	1	0	Normal	Normal	OFF	t <sub>WAKE-UP SLOW</sub>
	1	1	1	Full Performance	Full Performance	Normal	t <sub>WAKE-UP FAST</sub>
SVML	SVMLE	SVMLFP		AM, LPM0/1 SVML state	Manual SVSMLACE = 0	Automatic SVSMLACE = 1	Wakeup Time LPM2/3/4
					LPM2/3/4 SVML State	LPM2/3/4 SVML State	
	0	x	OFF	OFF	OFF	t <sub>WAKE-UP FAST</sub>	
	1	0	Normal	Normal	OFF	t <sub>WAKE-UP SLOW</sub>	
1	1	Full Performance	Full Performance	Normal	t <sub>WAKE-UP FAST</sub>		

and

-The SVSH/SVMH module is configured to transition from Normal mode to an OFF state when moving from Active/LPM0/LPM1 into LPM2/LPM3/LPM4 modes. The affected SVSMHCTL register settings are shaded in the following table.

	SVSHE	SVSHMD	SVSHFP	AM, LPM0/1 SVSH state	Manual SVSMHACE = 0	Automatic SVSMHACE = 1
					LPM2/3/4 SVSH State	LPM2/3/4 SVSH State
SVSH	0	x	x	OFF	OFF	OFF
	1	0	0	Normal	OFF	OFF
	1	0	1	Full Performance	OFF	OFF
	1	1	0	Normal	Normal	OFF
	1	1	1	Full Performance	Full Performance	Normal
SVMH	SVMHE	SVMHFP		AM, LPM0/1 SVMH state	Manual SVSMHACE = 0	Automatic SVSMHACE = 1
					LPM2/3/4 SVMH State	LPM2/3/4 SVMH State
	0	x	OFF	OFF	OFF	
	1	0	Normal	Normal	OFF	
1	1	Full Performance	Full Performance	Normal		

**Workaround**

Any write to the SVSMxCTL register must be followed by a settling delay (PMMIFG.SVSMLDLYIFG = 0 and PMMIFG.SVSMHDLYIFG = 0) before entering LPM2, LPM3, LPM4.

and

1. Ensure the SVSx, SVMx are configured to prevent the issue from occurring by the following:

- Configure the SVSL module for slow wake up (SVSLFP = 0). Note that this will increase the wakeup time from LPM2/3/4 to twakeupslow (~150 us).

or

- Do not configure the SVSH/SVMH such that the modules transition from Normal mode to an OFF state on LPM entry and ensure SVSH/SVMH is in manual mode. Instead force the modules to remain ON even in LPMx. Note that this will cause increased power consumption when in LPMx.

Refer to the MSP430 Driver Library([MSPDRIVERLIB](#)) for proper PMM configuration functions.

Use the following function, PMM15Check (void), to determine whether or not the existing PMM configuration is affected by the erratum. The return value of the function is 1 if the configuration is affected, and 0 if the configuration is not affected.

unsigned char PMM15Check (void)

```
{
// First check if SVSL/SVML is configured for fast wake-up
if ( (!(SVSMLCTL & SVSLE)) || ((SVSMLCTL & SVSLE) && (SVSMLCTL & SVSLFP)) ||
    (!(SVSMLCTL & SVMLE)) || ((SVSMLCTL & SVMLE) && (SVSMLCTL & SVMLEFP)) )
{ // Next Check SVSH/SVMH settings to see if settings are affected by PMM15
if ((SVSMHCTL & SVSHE) && !(SVSMHCTL & SVSHFP))
{
if ( (!(SVSMHCTL & SVSHMD)) || ((SVSMHCTL & SVSHMD) &&
(SVSMHCTL & SVSMHACE)) )
```

```

return 1; // SVSH affected configurations
}
if ((SVSMHCTL & SVMHE) && (!(SVSMHCTL & SVMHFP)) && (SVSMHCTL &
SVSMHACE))
return 1; // SVMH affected configurations
}
return 0; // SVS/M settings not affected by PMM15
}
}

```

2. If fast servicing of interrupts is required, add a 150us delay either in the interrupt service routine or before entry into LPM3/LPM4.

## **PMM17**

### ***PMM Module***

#### **Category**

Functional

#### **Function**

Vcore exceed maximum limit of 2.0V.

#### **Description**

If the device is switching between active mode and LPM2/3/4 with very high frequency, the core voltage of the device, V<sub>CORE</sub>, may rise incrementally until it is beyond 2.0 V, which is the maximum allowable limit for digital circuitry internal to the MSP430. This increase may remain undetected in an application with no functional impact but could potentially result in decreased endurance and increased wear over the lifetime of the device, because the digital circuitry is continually subjected to overvoltage.

The accumulation of V<sub>core</sub> affects only older lot trace codes of mentioned revisions.

#### **Workaround**

The V<sub>CORE</sub> accumulation is fixed by enabling the prolongation mechanism in software. The following lines of code need to be implemented before periodic execution of LPM-to-AM-LPM. It is recommended to execute the code at program start:

ASM code:

```
mov.w #0x9602, &0110h;
```

```
bis.w #0x0800, &0112h;
```

C code:

```
*(unsigned int*)(0x0110)=0x9602;
```

```
*(unsigned int*)(0x0112)|=0x0800;
```

The automatic prolongation mechanism is disabled with a BOR and must be enabled after each boot code execution.

For detailed background information, affected LTCs and possible workaround(s) see V<sub>core</sub> Accumulation documentation in [SLAA505](#).

## **PMM18**

### ***PMM Module***

#### **Category**

Functional

#### **Function**

PMM supply overvoltage protection falsely triggers POR

#### **Description**

The PMM Supply Voltage Monitor (SVM) high side can be configured as overvoltage protection (OVP) using the SVMHOVPE bit of SVSMHCTL register. In this mode a POR should typically be triggered when DV<sub>CC</sub> reaches ~3.75V.

If the OVP feature of SVM high side is enabled going into LPM234, the SVM might trigger at DVCC voltages below 3.6V (~3.5V) within a few ns after wake-up. This can falsely cause an OVP-triggered POR. The OVP level is temperature sensitive during fail scenario and decreases with higher temperature (85 degC ~3.2V).

**Workaround** Use automatic control mode for high-side SVS & SVM (SVSMHCTL.SVSMHACE=1). The SVM high side is inactive in LPM2, LPM3, and LPM4.

## **PMM20** *PMM Module*

---

**Category** Functional

**Function** Unexpected SVSL/SVML event during wakeup from LPM2/3/4 in fast wakeup mode

**Description** If PMM low side is configured to operate in fast wakeup mode, during wakeup from LPM2/3/4 the internal VCORE voltage can experience voltage drop below the corresponding SVSL and SVML threshold (recommendation according to User's Guide) leading to an unexpected SVSL/SVML event. Depending on PMM configuration, this event triggers a POR or an interrupt.

---

**NOTE:** As soon the SVSL or the SVML is enabled in Normal performance mode the device is in slow wakeup mode and this erratum does not apply.

In addition, this erratum has sporadic characteristic due to an internal asynchronous circuit. The drop of Vcore does not have an impact on specified device performance.

---

**Workaround** If SVSL or SVML is required for application (to observe external disruptive events at Vcore pin) the slow wakeup mode has to be used to avoid unexpected SVSL/SVML events. This is achieved if the SVSL or the SVML is configured in "Normal" performance mode (not disabled and not in "Full" Performance Mode).

## **PORT15** *PORT Module*

---

**Category** Functional

**Function** In-system debugging causes the PMALOCKED bit to be always set

**Description** The port mapping controller registers cannot be modified when single-stepping or halting at break points between a valid password write to the PMAPWD register and the expected lock of the port mapping (PMAP) registers. This causes the PMAPLOCKED bit to remain set and not clear as expected.

Note: This erratum only applies to in-system debugging and is not applicable when operating in free-running mode.

**Workaround** Do not single step through or place break points in the port mapping configuration section of code.

## **PORT16** *PORT Module*

---

**Category** Functional

**Function** GPIO pins are driven low during device start-up

**Description** During device start-up, all of the GPIO pins are expected to be in the floating input state.

Due to this erratum, some of the GPIO pins are driven low for the duration of boot code execution during device start-up, if an external reset event (via the RST pin) interrupted the previous boot code execution. Boot code is always executed after a BOR, and the duration of this boot code execution is approximately 500us.

For a given device family, this erratum affects only the GPIO pins that are not available in the smallest package device family member, but that are present on its larger package variants.

---

**NOTE:** This erratum does not affect the smallest package device variants in a particular device family.

---

**Workaround**

Ensure that no external reset is applied via the RST pin during boot code execution of the device, which occurs 1us after device start-up.

---

**NOTE:** System application needs to account for this erratum in to ensure there is no increased current draw by the external components or damage to the external components in the system during device start-up.

---

**PORT19**
***PORT Module***


---

**Category**

Functional

**Function**

Port interrupt may be missed on entry to LPMx.5

**Description**

If a port interrupt occurs within a small timing window (~1MCLK cycle) of the device entry into LPM3.5 or LPM4.5, it is possible that the interrupt is lost. Hence this interrupt will not trigger a wakeup from LPMx.5.

**Workaround**

None

**RTC3**
***RTC\_A Module***


---

**Category**

Functional

**Function**

Unreliable write to RTC register

**Description**

A write access to the RTC registers (SEC, MIN, HOUR, DATE, MON, YEAR, DOW) may result in unexpected results. As a consequence the addressed register might not contain the written data, or some data can be accidentally written to other RTC registers.

**Workaround**

Use the RTC library routines, available as F541x/F543x code examples on the MSP430 Code Examples page ([www.ti.com/msp430](http://www.ti.com/msp430) > Software > Code Examples), which use carefully aligned MOV instructions. Library is listed as RTC\_Workaround.zip and includes both CCE and IAR example projects that show proper usage. Using this library, full access to RTC registers is possible.

**RTC6**
***RTC\_A Module***


---

**Category**

Functional

**Function**

the step size of the RTC frequency adjustment is twice the specified size.

**Description**

In BCD mode of operation, the step size of the RTC frequency adjustment is =+8ppm/-

4ppm. This is twice the size specified in the User's Guide.

In BCD mode, for up calibration this results in a step size per step of 8ppm (1024 cycles) instead of 4ppm (512 cycles). For down calibration this results in a step size per step of 4ppm (512 cycles) instead of 2ppm (256 cycles).

In Binary mode, the step size = +4ppm/-2ppm as per the spec.


**Workaround** In BCD mode of operation, half the calibration value could be written into RTCCAL register to compensate the doubled step size.

**SYS10** **SYS Module**

**Category** Functional

**Function** BSL entry sequence is subject to specific timing requirements

**Description** The BSL entry sequence requires that the low phase of the TEST/SBWTCK pin does not exceed 15us. This timing requirement is faster than most PC serial ports can provide, as shown in the following picture. If this requirement is not met, the entry sequence fails and the SYSBSLIND is not set.

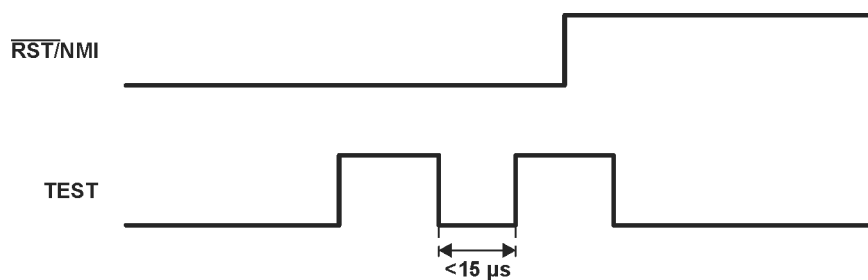

**Workaround** An external hardware solution is recommended to provide the appropriate BSL entry sequence. See [http://processors.wiki.ti.com/index.php/BSL\\_\(MSP430\)](http://processors.wiki.ti.com/index.php/BSL_(MSP430)) for recommendations on available BSL hardware.

Note: The erroneous behavior is only applicable if the default TI USB BSL is replaced by the TI UART BSL.

**SYS12** **SYS Module**

**Category** Functional

**Function** Invalid ACCVIFG when DVcc in the range of 2.4 to 2.6V

**Description** A Flash Access Violation Interrupt Flag (ACCVIFG) may be triggered by the Voltage Changed During Program Error bit (VPE) when DVcc is in the range of 2.4 to 2.6V. However the VPE does not signify an invalid flash operation has occurred.

If the ACCVIE bit is set and a flash operation is executed in the affected voltage range, an unnecessary interrupt is requested. The bootstrap loader also cannot be used to execute write/erase flash operations in this voltage range, because it exits the flash operation and returns an error on an ACCVIFG event.

**Workaround** None



**SYS16**
***SYS Module***
**Category**

Functional

**Function**

Fast Vcc ramp after device power up may cause a reset

**Description**

At initial power-up, after Vcc crosses the brownout threshold and reaches a constant level, an abrupt ramp of Vcc at a rate  $dV/dT > 1V/100\mu s$  can cause a brownout condition to be incorrectly detected even though Vcc does not fall below the brownout threshold. This causes the device to undergo a reset.

**Workaround**

Use a controlled Vcc ramp to power up the device.

**SYS18**
***USB Module***
**Category**

Functional

**Function**

USB registers are unlocked and ACCVIFG is set at start-up

**Description**

During device start-up, an incorrect line of code in the start-up code causes the USB registers to remain unlocked and causes an access violation, setting ACCVIFG bit.

In the BSL430\_Low\_Level\_Init code, the following line of code accesses USBKEY (incorrect register address) instead of USBKEYPID, causing an access violation setting ACCVIFG bit, and leaving the USB registers unlocked.

```
mov.w #0x0000, &USBKEY ; lock USB
```

The correct line of code should read:

```
mov.w #0x0000, &USBKEYPID ; lock USB correctly
```

Note: This code does not run when using the JTAG debugger - the behavior only appears when running standalone.

**Workaround**

1. Load the latest version of the USB BSL from [Custom BSL Download](#)

OR

2. Load a non-USB or custom BSL

OR

3. Erase the BSL

OR

4. Clear the access violation flag at the beginning of the application code with the following C code (or its assembly equivalent):

```
USBKEYPID = 0;           // Lock USB correctly
FCTL3 = 0xA558;         // Clear violation flag
```

**TAB23**
***TIMER\_A/TIMER\_B Module***
**Category**

Functional

**Function**

TAxR/TBxR read can be corrupted when TAxR/TBxR = TAxCCR0/TBxCCR0

**Description**

When a timer in Up mode is stopped and the counter register (TAxR/TBxR) is equal to the TAxCCR0/TBxCCR0 value, a read of the TAR/TBR register may return an unexpected result.

<b>Workaround</b>	<ol style="list-style-type: none"> <li>1. Use 'Up/Down' mode instead of 'Up' mode</li> </ol> <p>OR</p> <ol style="list-style-type: none"> <li>2. In 'Up' mode, use the timer interrupt instead of halting the counter and reading out the value in TAxR/TBxR</li> </ol> <p>OR</p> <ol style="list-style-type: none"> <li>3. When halting the timer counter in 'Up' mode, reinitialize the timer before starting to run again.</li> </ol>
<hr/>	
<b>UCS6</b>	<b><i>UCS Module</i></b>
<b>Category</b>	Functional
<b>Function</b>	USCI source clock does not turn off in LPM3/4 when UART is idle
<b>Description</b>	The USCI clock source (ACLK/SMCLK) remains enabled in LPM3 and LPM4 when the USCI is configured in UART mode and the communication is idle (UCSWRST = 0 but no TX or RX currently executing). This is contrary to the expected automatic clock activation described in the User's Guide and can lead to higher current consumption in low power modes, depending on the oscillator that feeds ACLK / SMCLK.
<b>Workaround</b>	Use the oscillator that is already active in LPM3 (ACLK) to source the USCI and utilize the low-power baud rate generator (UCOS16 = 0). For UART baud rates where a fast SMCLK sourced by the internal DCO is required use LPM0 instead of LPM3.
<hr/>	
<b>UCS7</b>	<b><i>UCS Module</i></b>
<b>Category</b>	Functional
<b>Function</b>	DCO drifts when servicing short ISRs when in LPM0 or exiting active from ISRs for short periods of time
<b>Description</b>	<p>The FLL uses two rising edges of the reference clock to compare against the DCO frequency and decide on the required modifications to the DCOx and MODx bits. If the device is in a low power mode with FLL disabled (LPM0 with DCO not sourcing ACLK/SMCLK or LPM2, LPM3, LPM4 where SCG1 bit is set) and enters a state which enables FLL (enter ISR from LPM0/LPM2 or exit active from ISRs) for a period less than 3x reference clock cycles, then the FLL will cause the DCO to drift.</p> <p>This occurs because the FLL immediately begins comparing an active DCO with its reference clock and making the respective modifications to the DCOx and MODx bits. If the FLL is not given sufficient time to capture a full reference clock cycle (2 x reference clock periods) and adjust accordingly (1 x reference clock period), then the DCO will keep drifting each time the FLL is enabled.</p>
<b>Workaround</b>	<ol style="list-style-type: none"> <li>(1) If DCO is not sourcing ACLK or SMCLK in the application, use LPM1 instead of LPM0 to make sure FLL is disabled when interrupt service routine is serviced.</li> <li>(2) When exiting active from ISRs, insert a delay of at least 3 x reference clock periods. To save on power budget, the 3 x reference clock periods could also be spent in LPM0 with TimerA or TimerB using ACLK/SMCLK sourced from DCO. This way, the FLL and DCO are still active in LPM0.</li> </ol>
<hr/>	
<b>UCS9</b>	<b><i>UCS Module</i></b>
<b>Category</b>	Functional

<b>Function</b>	Digital Bypass mode prevents entry into LPM4
<b>Description</b>	When entering LPM4, if an external digital input applied to XT1 in HF mode or XT2 is not turned off, the PMM does not switch to low-current mode causing higher than expected power consumption.
<b>Workaround</b>	<p>Before entering LPM4:</p> <p>(1) Switch to a clock source other than external bypass digital input.</p> <p>OR</p> <p>(2) Turn off external bypass mode (UCSCTL6.XT1BYPASS = 0).</p>

## UCS10

### *UCS Module*

<b>Category</b>	Functional
<b>Function</b>	Modulation causes shift in DCO frequency
<b>Description</b>	<p>When the FLL is enabled, the DCO frequency can be tracked automatically by modifying the DCOx and MODx bits. The MODx bits switch between the frequency selected by the DCO bits and the next-higher frequency set by (DCO + 1). The erroneous behavior is seen when the FLL is tracking close to a DCO step boundary and the MOD counter is expected to rollover, but instead the DCO bits increment and the MOD bits decrement. This causes the DCO to shift by up to 12% and remain at an increased frequency until approximately 15 REFCLK cycles have elapsed. The frequency reverts to the expected value immediately afterward.</p> <p>For example, the modulator moves from DCOx = n and MODx = 31 to DCOx = n + 1 and MODx = 30, causing a large increase in the DCO frequency.</p> <p>Applications could be impacted as follows:</p> <p>When using the DCO frequency for asynchronous serial communication and timer operation, the effect can be seen as corrupted data or incorrect timing events.</p>
<b>Workaround</b>	<p>(1) Turn off the FLL.</p> <p>Or</p> <p>(2) Implement a Software FLL, comparing the DCO frequency to a known reference such as REFO or LFXT1 using a timer capture and tuning the value of the DCO and MOD bits periodically.</p> <p>Or</p> <p>(3) Execute the following sequence in periodic intervals.</p> <ol style="list-style-type: none"> <li>1. Disable peripherals sourced by the DCO such as UART and Timer.</li> <li>2. Turn on the FLL.</li> <li>3. Wait the worst case settling time of <math>32 \times 32 \times f_{FLLREFCLK}</math> to allow it to lock to the target frequency.</li> <li>4. Turn off the FLL.</li> <li>5. Compare the DCO frequency to a known reference such as REFO or LFXT1 using a timer capture.</li> </ol> <p>- If the DCO frequency is higher than expected, repeat from step (2) until the frequency reaches to the expected range.</p> <p>- Else proceed with code execution.</p>

See the application report UCS10 Guidance [SLAA489](#) for more detailed information regarding working with this erratum. This erratum does not affect proper operation of the CPU when MCLK = DCO/FLL and is set to the maximum clock frequency specified in the device datasheet.

## UCS11

### **UCS Module**

---

**Category**

Functional

**Function**

Modifying UCSCTL4 clock control register triggers an additional erroneous clock request

**Description**

Changing the SELM/SELS/SELA bits in the UCSCTL4 register will correctly configure the respective clock to use the intended clock source but might also erroneously set XT1/XT2 fault flag if the crystals are not present at XT1/XT2 or not configured in the application firmware. If the NMI interrupt for the OFIFG is enabled, an unintentional NMI interrupt will be triggered and needs to be handled.

---

**NOTE:** The XT1/XT2 fault flag can be set regardless of which SELM/SELS/SELA bit combinations are being changed.

---

**Workaround**

Clear all the fault flags in UCSCTL7 register once after changing any of the SELM/SELS/SELA bits in the UCSCTL4 register.

If OFIFG-NMI is enabled during clock switching, disable OFIFG-NMI interrupt during changing the SELM/SELS/SELA bits in the UCSCTL4 register to prevent unintended NMI.

Alternatively it can be handled accordingly (clear falsely set fault flags) in the Interrupt Service Routine to ensure proper OFIFG clearing.

## USB4

### **USB Module**

---

**Category**

Functional

**Function**

USB control registers cannot be modified during USB Function Reset when FRSTE = 1

**Description**

If the function reset connection enable (FRSTE) bit in the USBCTL register is set and the USB host asserts reset over the USB bus, then the USB control registers cannot be modified until the host reset is de-asserted. The FRSTE bit is used to enable the USB function reset to reset of all internal logic of the USB module and is used to reduce the software overhead of USB reset handling.

**Workaround**

Clear the FRSTE bit inside the RSTRIFG interrupt service routine before reconfiguring the USB control registers, and set the FRSTE bit at the beginning of SUSRIFG, SETUPIFG, IEPIFG.EP0, and OEPIFG.EP0 interrupt service routines.

NOTE: TI supplied stacks implement this software workaround

## USB6

### **USB Module**

---

**Category**

Functional

**Function**

Endpoint0 STALL bit can be cleared during USBIEPCNFG\_0/ USBOEPCNFG\_0 register access

**Description**

According to the MSP430F5xx Family User's Guide ([SLAU208](#)), the STALL bit in the Endpoint0 configuration register should be set by software when there is either an

unsupported control request or a control request fail or an endpoint halt, and this bit is automatically cleared by the next setup transaction. In correct operation, the hardware clearing of the Endpoint0 STALL bit should not occur when the configuration registers USBIEPCNFG\_0/USBOEPCNFG\_0 are being accessed even though the next set-up transaction required to clear the STALL bit has occurred. Rather, the hardware clear of the STALL bit should wait until the access is finished, and then clear the bit.

However due to the erratum, if the next setup transaction occurs while the USBIEPCNFG\_0/USBOEPCNFG\_0 registers are being accessed, the STALL bit will be cleared immediately. This can be a problem during write accesses; for example, if the application tries to set the STALL bit and the next set-up transaction has cleared it. In this case, a valid STALL condition might be missed.

**Workaround**

- Set the STALL bit inside the SETUP ISR. The STALL bit is automatically cleared on entering SETUP ISR so the user does not need to check it is cleared before setting STALL = 1.

or

- Poll the STALL bit to verify it is cleared, then set STALL = 1.

NOTE: The USB stacks supplied by TI implement the first software workaround.

**USB8**
***USB Module***
**Category**

Functional

**Function**

USB PLL may fail to initialize when DCO is not used

**Description**

If the DCO is not used or does not source any clock in the system, the PLL may not initialize properly, leading to a "bus error" NMI when the CPU attempts to access USB memory. Under certain conditions, the PLL requires the DCO to be active in order to initialize properly. If any of the system clocks (MCLK, SMCLK, ACLK) are derived from the DCO during PLL initialization, this condition is satisfied and the PLL initializes in a stable manner.

**Workaround**

- Configure one of the system clocks to use the DCO for normal operation. (In most applications, it's convenient to source MCLK from the DCO.)

or

- If it's necessary to use a clock configuration that doesn't include the DCO, then briefly activate it, then de-activate it. This should be done after setting the UPLEN bit but before polling the USBPLLIR flags. The code below shows a simplified PLL initialization procedure. (In the MSP430 USB API Stacks, this is performed in USB\_enable().)

```
USBPLLCTL |= UPLEN; // Enable PLL
```

```
// Add the following code to enable the DCO, then immediately revert back
```

```
// to the original clock settings for the application. This is long
```

```
// enough to allow PLL initialization to proceed. The actual UCSCTL4
```

```
// settings depend on the application's clock requirements.
```

```
UCSCTL4 = SELA__REFOCLK + SELS__XT2CLK + SELM__DCOCLK; // Enable the DCO
```

```
UCSCTL4 = SELA__REFOCLK + SELS__XT2CLK + SELM__XT2CLK; // Revert back
```

```
//Wait for the PLL to settle
```

```
do {
```

```
    USBPLLIR = 0x0000; // Clear the flags
```

```

for (i =0; i < 400; i++); // Wait for flags to set if not stable yet
}while (USBPLLIR != 0);
// PLL is now stable

```

**USB9**
***USB Module***


---

**Category**

Functional

**Function**

VBUS detection may fail after powerup

**Description**

In rare cases, some USB-equipped MSP430 devices may experience a failure in the bandgap that aids in detecting the presence of 5 V on the VBUS pin. Two primary effects of this are:

- The USBBGVBV bit fails to show the presence of a valid voltage on the VBUS pin.
- and
- The USB LDOs fail to start.

**Workaround**

This error state can be "reset" by clearing all of the bits in the USBPWRCTL register, which disables the USB LDOs, among other actions. The bits can then be set again normally, and the device functions properly.

This has been added to the USB\_Init() function in v3.10 and later of the MSP430 USB API. Therefore, this problem is automatically addressed in applications that use the API.

However, if the integrated 3.3-V USB LDO (the output of the VUSB pin) is used to power the device's DVCC pin, as in many bus-powered applications, and if the rare bandgap error occurs, the CPU fails to power up, because the USB LDO fails to operate. The problem might be resolved by cycling power to the VBUS pin; for example, if the end user responds to the failure by unplugging and replugging the USB cable. The bandgap failure is also known to occur more often with slow DVCC ramps > 200 ms; for example, when there is excessive capacitance on the DVCC pin, in excess of what the USB specification allows. However, the only sure way to prevent the problem from occurring in the first place is to avoid making DVCC power reliant on VUSB.

**USB10**
***USB Module***


---

**Category**

Functional

**Function**

USB interface may begin to endlessly transmit to the USB host when a rare timing event occurs between the USB host and MSP430 software execution

**Description**

When the host sends a SETUP packet for an IN transaction, the SETUPIFG bit always gets set by hardware, and the USB ISR is triggered. While SETUPIFG is high, the host's attempts to continue the transaction with IN packets are automatically NAKed.

When the SETUP packet has been decoded and the IN data prepared, the USB ISR clears the SETUPIFG bit. But if it happens to do so within the 2nd CRC bit of an IN packet from the host, the USB module enters an errant state and can begin to endlessly transmit to the host, irrespective of the protocol. The errant state can be cleared by resetting the module with the USB\_EN bit; but there's no way for software to reliably detect the condition.

Since the 2nd CRC bit is only an 83ns window, the problem is extremely rare. However, since the timing of IN packets relative to their preceding SETUP packets can vary according to the host's timing, there's no way to ensure for certain that it will never happen.

**Workaround**

If the problem behavior occurs, and if the MSP430 is bus-powered, the user may

naturally unplug/re-plug the device's USB connection. If this occurs, the behavior will be corrected because power to the MSP430 will be cycled. After this, it's unlikely the problem will occur again soon, since the failure is usually rare.

The behavior can be prevented altogether by clearing the UBME bit immediately before clearing SETUPIFG, and setting it again immediately after:

```

        USBIEPCNF_0 &= ~EPCNF_UBME; // Clear ME to gate off SETUPIFG
clear event
        USBOEPCNF_0 &= ~EPCNF_UBME; // Clear ME to gate off SETUPIFG
clear event
        USBIFG &= ~SETUPIFG; // clear the interrupt bit
        USBIEPCNF_0 |= EPCNF_UBME; // Set ME to continue with normal
operation
        USBOEPCNF_0 |= EPCNF_UBME; // Set ME to continue with normal
operation

```

This workaround is reliable and effective. However, as a side effect, it results in the creation of orphan tokens on the USB interface. Although the workaround is field-tested, and no problems have been reported with these orphan packets, it is recommended to use the workaround only if the errata behavior is problematic for the application in question.

## USB11

### **USB Module**

---

**Category**

Functional

**Function**

USB BSL invoke

**Description**

For devices with USB BSL, when externally invoking BSL according SLAU319 chapter 1.3.3, a critical setup time may not be met. In this case the BSL will not start. The pass/fail condition is temperature-dependent, where if a unit passes at a certain temperature, it will always pass at the same or higher temperature condition.

**Workaround**

1. Invoke the BSL from the application code and ensure VCore is set to level 2 or 3 prior to BSL entry.

OR

2. Update the device BSL. The CustomBSL source code implements the fix for this errata in versions 1.00.05.00 and newer. The CustomBSL package can be download at [Custom BSL package](#)

## USB12

### **USB Module**

---

**Category**

Functional

**Function**

The 2nd byte of a slave-to-host transmission is sent twice.

**Description**

In extremely rare cases, when the USB module's PLL is disabled (by clearing the UPLLEN bit), the USB module can be placed into an undetermined state, resulting in an extra byte being sent to the host over the bus. The PLL is usually disabled by software when the USB module detects that the USB device has been suspended by the host. Suspend events can occur at any time, but are typically invoked during periods of inactivity.

**Workaround**

Once this error occurs, the USB module needs to be reset (by clearing the USBEN bit), and then the module can be re-initialized. For example, software can call the MSP430 USB API `USB_disable()` followed by `USB_enable()`. These actions are taken by the USB APIs when the user unplugs and replugs the USB cable, which is likely to happen when

the user realizes the bus is no longer working.

If automatic detection of the error is required, then software on the host and device could implement a CRC check on the data payload (above the USB API) to detect the extra byte. If detected, software could then disable/re-enable the USB module. (The CRC inherent in the USB protocol calculates over the data packet, and thus cannot detect the erroneously added byte.)

**USB13**
***USB Module***


---

**Category**

Functional

**Function**

USB BSL invoke is not working when device powered via USB

**Description**

If the device is powered via the 3.3V USB LDO the BSL invoke might not work once the USB cable is plugged in depending on the on board capacitance connected to DVCC/AVCC.

The failure will be caused by the BSL code which is creating a voltage dip on the supply preventing successful code execution.

**Workaround**

1. Increasing the capacitance on DVCC/AVCC (typical 30 uF). However site effect on application needs to be considered.

Or

2. Update the USB BSL via JTAG with the latest USB BSL revision (version 00.08.88.39 or later).

**USCI26**
***USCI Module***


---

**Category**

Functional

**Function**

Tbuf parameter violation in I2C multi-master mode

**Description**

In multi-master I2C systems the timing parameter Tbuf (bus free time between a stop condition and the following start) is not guaranteed to match the I2C specification of 4.7us in standard mode and 1.3us in fast mode. If the UCTXSTT bit is set during a running I2C transaction, the USCI module waits and issues the start condition on bus release causing the violation to occur.

Note: It is recommended to check if UCBBUSY bit is cleared before setting UCTXSTT=1.

**Workaround**

None

**USCI30**
***USCI Module***


---

**Category**

Functional

**Function**

I2C mode master receiver / slave receiver

**Description**

When the USCI I2C module is configured as a receiver (master or slave), it performs a double-buffered receive operation. In a transaction of two bytes, once the first byte is moved from the receive shift register to the receive buffer the byte is acknowledged and the state machine allows the reception of the next byte.

If the receive buffer has not been cleared of its contents by reading the UCxBRXBUF register while the 7th bit of the following data byte is being received, an error condition may occur on the I2C bus. Depending on the USCI configuration the following may occur:



1) If the USCI is configured as an I2C master receiver, an unintentional repeated start condition can be triggered or the master switches into an idle state (I2C communication aborted). The reception of the current data byte is not successful in this case.

2) If the USCI is configured as I2C slave receiver, the slave can switch to an idle state stalling I2C communication. The reception of the current data byte is not successful in this case. The USCI I2C state machine will notify the master of the aborted reception with a NACK.

Note that the error condition described above occurs only within a limited window of the 7th bit of the current byte being received. If the receive buffer is read outside of this window (before or after), then the error condition will not occur.

**Workaround**

a) The error condition can be avoided altogether by servicing the UCBxRXIFG in a timely manner. This can be done by (a) servicing the interrupt and ensuring UCBxRXBUF is read promptly or (b) Using the DMA to automatically read bytes from receive buffer upon UCBxRXIFG being set.

OR

b) In case the receive buffer cannot be read out in time, test the I2C clock line before the UCBxRXBUF is read out to ensure that the critical window has elapsed. This is done by checking if the clock line low status indicator bit UCSCLOW is set for atleast three USCI bit clock cycles i.e.  $3 \times t(\text{BitClock})$ .

Note that the last byte of the transaction must be read directly from UCBxRXBUF. For all other bytes follow the workaround:

Code flow for workaround

- (1) Enter RX ISR for reading receiving bytes
- (2) Check if UCSCLOW.UCBxSTAT == 1
- (3) If no, repeat step 2 until set
- (4) If yes, repeat step 2 for a time period  $> 3 \times t(\text{BitClock})$  where  $t(\text{BitClock}) = 1/f(\text{BitClock})$
- (5) If window of  $3 \times t(\text{BitClock})$  cycles has elapsed, it is safe to read UCBxRXBUF

**USCI31**
***USCI Module***
**Category**

Functional

**Function**

Framing Error after USCI SW Reset (UCSWRST)

**Description**

While receiving a byte over USCI-UART (with UCBUSY bit set), if the application resets the USCI module (software reset via UCSWRST), then a framing error is reported for the next receiving byte.

**Workaround**

1. If possible, do not reset USCI-UART during an ongoing receive operation; that is, when UCBUSY bit is set.
2. If the application software resets the USCI module (via the UCSWRST bit) during an ongoing receive operation, then set and reset the UCSYNC bit before releasing the software USCI reset.

Workaround code sequence:

```
bis #UCSWRST, &UCAxCTL1 ; USCI SW reset
```

```
;Workaround begins
```

```
bis #UCSYNC, &UCAxCTL0 ; set synchronous mode
```

```
bic #UCSYNC, &UCAxCTL0 ; reset synchronous mode
;Workaround ends
bic #UCSWRST, &UCAxCTL1 ; release USCI reset
```

**USCI34**
***USCI Module***
**Category**

Functional

**Function**

I2C multi-master transmit may lose first few bytes.

**Description**

In an I2C multi-master system (UCMM =1), under the following conditions:

(1)the master is configured as a transmitter (UCTR =1)  
AND  
(2)the start bit is set (UCTXSTT =1);

if the I2C bus is unavailable, then the USCI module enters an idle state where it waits and checks for bus release. While in the idle state it is possible that the USCI master updates its TXIFG based on clock line activity due to other master/slave communication on the bus. The data byte(s) loaded in TXBUF while in idle state are lost and transmit pointers initialized by the user in the transmit ISR are updated incorrectly.

**Workaround**

Verify that the START condition has been sent (UCTXSTT =0) before loading TXBUF with data.

Example:

```
#pragma vector = USCIAB0TX_VECTOR
__interrupt void USCIAB0TX_ISR(void)
{
// Workaround for USCI34
if(UCB0CTL1&UCTXSTT)
{
// TXData = pointer to the transmit buffer start
// PTxData = pointer to transmit in the ISR
PTxData = TXData; // restore the transmit buffer pointer if the Start bit is set
}
//
if(IFG2&UCB0TXIFG)
{
if (PTxData<=PTxDataEnd) // Check TX byte counter
{
UCB0TXBUF = *PTxData++; // Load TX buffer
}
else
{
UCB0CTL1 |= UCTXSTP; // I2C stop condition
IFG2 &= ~UCB0TXIFG; // Clear USCI_B0 TX int flag
```

```

__bic_SR_register_on_exit(CPUOFF); // Exit LPM0
}
}
}

```

**USCI35** *USCI Module*


---

**Category** Functional

**Function** Violation of setup and hold times for (repeated) start in I2C master mode

**Description** In I2C master mode, the setup and hold times for a (repeated) START,  $t_{SU,STA}$  and  $t_{HD,STA}$  respectively, can be violated if SCL clock frequency is greater than 50kHz in standard mode (100kbps). As a result, a slave can receive incorrect data or the I2C bus can be stalled due to clock stretching by the slave.

**Workaround** If using repeated start, ensure SCL clock frequencies is < 50kHz in I2C standard mode (100 kbps).

**USCI39** *USCI Module*


---

**Category** Functional

**Function** USCI I2C IFGs UCSTTIFG, UCSTPIFG, UCNACKIFG

**Description** Unpredictable code execution can occur if one of the hardware-clear-able IFGs UCSTTIFG, UCSTPIFG or UCNACKIFG is set while the global interrupt enable is set by software (GIE=1). This erratum is triggered if ALL of the following events occur in following order:

1. Pending Interrupt: One of the UCxIFG=1 AND UCxIE=1 while GIE=0
2. The GIE is set by software (e.g. EINT)
3. The pending interrupt is cleared by hardware (external I2C event) in a time window of 1 MCLK clock cycle after the "EINT" instruction is executed.

**Workaround** Disable the UCSTTIE, UCSTPIE and UCNACKIE before the GIE is set. After GIE is set, the local interrupt enable flags can be set again.

Assembly example:

```
bic #UCNACKIE+UCSTPIE+UCSTTIE, UCBxIE ; disable all self-clearing interrupts
```

```
NOP
```

```
EINT
```

```
bis #UCNACKIE+UCSTPIE+UCSTTIE, UCBxIE ; enable all self-clearing interrupts
```

**USCI40** *USCI Module*


---

**Category** Functional

**Function** SPI Slave Transmit with clock phase select = 1

**Description** In SPI slave mode with clock phase select set to 1 (UCAxCTLW0.UCCKPH=1), after the first TX byte, all following bytes are shifted by one bit with shift direction dependent on UCMSB. This is due to the internal shift register getting pre-loaded asynchronously when writing to the USCIA TXBUF register. TX data in the internal buffer is shifted by one bit

after the RX data is received.

**Workaround**

Reinitialize TXBUF before using SPI and after each transmission.

If transmit data needs to be repeated with the next transmission, then write back previously read value:

```
UCAxTXBUF = UCAxTXBUF;
```

**WDG4**
***WDT\_A Module***


---

**Category**

Functional

**Function**

The WDT failsafe can be disabled

**Description**

The UCS is capable of masking clock requests (ACLK, SMCLK, MCLK) from peripheral modules; see request enable (REQEN) bits in the UCS control register, UCSCTL8.

The clock request logic of the UCS is used by the WDT module to ensure a fail-safe clock source in all low-power modes. Therefore, de-asserting the request enable bit of the watchdog clock source (xCLKREQEN = 0) allows the respective clock to be disabled upon entry into a low-power mode. Without an active clock source, the WDT timer stops incrementing and a watchdog event will not occur.

**Workaround**

None

## 8 Document Revision History

Changes from family erratasheet to device specific erratasheet.

1. Errata JTAG21 was removed
2. Errata RTC4 was removed
3. Revision H was added
4. PMM17 is impacting silicon revision E

Changes from device specific erratasheet to document Revision A.

1. Errata DMA10 was added to the errata documentation.
2. Errata PORT19 was added to the errata documentation.
3. Errata PMM18 was added to the errata documentation.
4. Errata RTC6 was added to the errata documentation.
5. Errata SYS18 was added to the errata documentation.

Changes from document Revision A to Revision B.

1. DMA10 Workaround was updated.
2. DMA10 Description was updated.

Changes from document Revision B to Revision C.

1. Errata BSL7 was added to the errata documentation.
2. Silicon Revision I was added to the errata documentation.
3. Errata RTC3 was added to the errata documentation.
4. DMA10 Description was updated.

Changes from document Revision C to Revision D.

1. Errata BSL6 was added to the errata documentation.
2. DMA10 Description was updated.
3. DMA10 Function was updated.

Changes from document Revision D to Revision E.

1. DMA10 Description was updated.
2. BSL6 Workaround was updated.
3. MPY1 Description was updated.
4. Errata EEM23 was added to the errata documentation.
5. Errata CPU43 was added to the errata documentation.

Changes from document Revision E to Revision F.

1. SYS16 Description was updated.
2. CPU43 Description was updated.
3. Errata USCI34 was added to the errata documentation.
4. Device TLV Hardware Revision information added to erratasheet.

Changes from document Revision F to Revision G.

1. Errata PMM20 was added to the errata documentation.
2. Errata USCI35 was added to the errata documentation.

Changes from document Revision G to Revision H.

1. BSL7 Workaround was updated.
2. BSL7 Function was updated.
3. Errata USB10 was added to the errata documentation.

Changes from document Revision H to Revision I.

1. Errata BSL12 was added to the errata documentation.

2. EEM19 Workaround was updated.
3. EEM13 Workaround was updated.
4. EEM23 Workaround was updated.
5. EEM17 Description was updated.
6. EEM23 Description was updated.
7. EEM15 Workaround was updated.
8. EEM17 Workaround was updated.
9. PORT16 Workaround was updated.
10. CPU43 Description was updated.
11. EEM11 Workaround was updated.
12. EEM14 Workaround was updated.
13. EEM16 Description was updated.
14. PORT16 Description was updated.
15. EEM16 Workaround was updated.
16. EEM19 Description was updated.

Changes from document Revision I to Revision J.

1. DMA10 Workaround was updated.
2. DMA10 Description was updated.
3. Errata BSL12 was removed from the errata documentation.
4. DMA10 Function was updated.
5. Errata USB11 was added to the errata documentation.

Changes from document Revision J to Revision K.

1. CPU40 Workaround was updated.
2. EEM19 Workaround was updated.
3. Errata USCI39 was added to the errata documentation.
4. Package Markings section was updated.
5. EEM23 Workaround was updated.
6. EEM23 Description was updated.
7. Errata ADC42 was added to the errata documentation.
8. EEM23 Function was updated.
9. Errata USB12 was added to the errata documentation.
10. EEM19 Description was updated.

Changes from document Revision K to Revision L.

1. ADC29 Formatting was updated.

Changes from document Revision L to Revision M.

1. Errata USCI40 was added to the errata documentation.
2. Errata CPU43 was removed from the errata documentation.
3. Module name for SYS18 was modified.
4. SYS18 Workaround was updated.
5. PMM18 Workaround was updated.

Changes from document Revision M to Revision N.

1. DMA7 Workaround was updated.
2. EEM23 Description was updated.
3. DMA7 Description was updated.
4. Silicon Revision K was added to the errata documentation.

Changes from document Revision N to Revision O.

1. USCI39 Description was updated.

Changes from document Revision O to Revision P.

1. Errata JTAG26 was added to the errata documentation.

Changes from document Revision P to Revision Q.

1. EEM19 Workaround was updated.

Changes from document Revision Q to Revision R.

1. RTC6 Description was updated.
2. UCS11 Workaround was updated.
3. UCS11 Description was updated.
4. UCS11 Function was updated.

Changes from document Revision R to Revision S.

1. Errata JTAG27 was added to the errata documentation.
2. Errata COMP10 was added to the errata documentation.

Changes from document Revision S to Revision T.

1. Errata USB13 was added to the errata documentation.
2. JTAG20 Workaround was updated.
3. USCI39 Workaround was updated.
4. SYS12 Description was updated.

Changes from document Revision T to Revision U.

1. CPU21 was added to the errata documentation.
2. CPU23 was added to the errata documentation.
3. CPU22 was added to the errata documentation.
4. ADC25 is no longer impacting silicon Revision K
5. Workaround for CPU27 was updated.
6. Function for CPU26 was updated.
7. Description for CPU26 was updated.
8. Workaround for CPU26 was updated.
9. Workaround for CPU29 was updated.
10. Workaround for CPU28 was updated.
11. Workaround for PMM15 was updated.
12. Workaround for CPU30 was updated.
13. Workaround for CPU32 was updated.
14. Workaround for CPU31 was updated.
15. Workaround for CPU39 was updated.
16. Workaround for CPU34 was updated.
17. Workaround for CPU33 was updated.
18. Workaround for CPU35 was updated.
19. Workaround for CPU40 was updated.

Changes from document Revision U to Revision V.

1. TLV hardware revision ID for Rev D was updated.
2. TLV hardware revision ID for Rev C was updated.
3. TLV hardware revision ID for Rev K was updated.

Changes from document Revision V to Revision W.

1. Workaround for PMM15 was updated.

Changes from document Revision W to Revision X.

1. Description for RTC6 was updated.
2. Workaround for RTC6 was updated.

Changes from document Revision X to Revision Y.

1. Erratasheet format update.
2. Added errata category field to "Detailed bug description" section

Changes from document Revision Y to Revision Z.

1. Workaround for CPU40 was updated.

Changes from document Revision Z to Revision AA.

1. Function for USB10 was updated.
2. Description for USB10 was updated.

Changes from document Revision AA to Revision AB.

1. CPU47 was added to the errata documentation.
2. ADC69 was added to the errata documentation.

Changes from document Revision AB to Revision AC.

1. Workaround for USCI34 was updated.



## IMPORTANT NOTICE AND DISCLAIMER

TI PROVIDES TECHNICAL AND RELIABILITY DATA (INCLUDING DATASHEETS), DESIGN RESOURCES (INCLUDING REFERENCE DESIGNS), APPLICATION OR OTHER DESIGN ADVICE, WEB TOOLS, SAFETY INFORMATION, AND OTHER RESOURCES "AS IS" AND WITH ALL FAULTS, AND DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING WITHOUT LIMITATION ANY IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE OR NON-INFRINGEMENT OF THIRD PARTY INTELLECTUAL PROPERTY RIGHTS.

These resources are intended for skilled developers designing with TI products. You are solely responsible for (1) selecting the appropriate TI products for your application, (2) designing, validating and testing your application, and (3) ensuring your application meets applicable standards, and any other safety, security, or other requirements. These resources are subject to change without notice. TI grants you permission to use these resources only for development of an application that uses the TI products described in the resource. Other reproduction and display of these resources is prohibited. No license is granted to any other TI intellectual property right or to any third party intellectual property right. TI disclaims responsibility for, and you will fully indemnify TI and its representatives against, any claims, damages, costs, losses, and liabilities arising out of your use of these resources.

TI's products are provided subject to TI's Terms of Sale ([www.ti.com/legal/termsofsale.html](http://www.ti.com/legal/termsofsale.html)) or other applicable terms available either on [ti.com](http://ti.com) or provided in conjunction with such TI products. TI's provision of these resources does not expand or otherwise alter TI's applicable warranties or warranty disclaimers for TI products.

Mailing Address: Texas Instruments, Post Office Box 655303, Dallas, Texas 75265  
Copyright © 2019, Texas Instruments Incorporated